

**DISTRICT I**

P. O. Box 1980, Hobbs, NM 88240

**DISTRICT II**

P. O. Drawer DD, Artesia, NM 88210

**DISTRICT III**

1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P. O. Box 2088  
Santa Fe, NM 87504-2088

WELL API NO.

30-025-32930

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

B-2148

7. Lease Name or Unit Agreement Name

Caprock Maljamar Unit

8. Well No.

163

9. Pool name or Wildcat

Maljamar Grayburg San Andres

**SUNDRY NOTICES AND REPORTS ON WELLS**

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1 Type of Well:

OIL ☒ GAS ☐  
WELL WELL OTHER

2. Name of Operator

The Wiser Oil Company

3. Address of Operator

P.O. Box 2568 Hobbs, New Mexico 88241 (505) 392-9797

4. Well Location

Unit Letter O : 45 Feet From The South Line and 1349 Feet From The East Line

Section 18 Township 17S Range 33E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4218' GR

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO**

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: Re-perf. & acidize ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5/10/00 MIRU Tyler Well Service. POH w/rods & pump. ND WH. RU BOP. RU swab. Swabbed tbg. down to backside. POH w/2-7/8" tbg. LD blast jt., SN & BHA. RIH w/4-3/4" x 4-1/2" wash pipe shoe, 6 jts. 4-1/2" wash pipe, 2-3/8" x 4-1/2" crossover, Johnson jars, 6 3-1/2" DC's, 2-7/8" x 3-1/2" crossover & 100 jts. 2-7/8" tbg. Left hanging @ 3450'.

5/11/00 Tag @ 4491'. Pull up 30' & broke circulation. Set @ 4491'. Wash over fish. Returns show carbonate scale, iron sulfide & metal.

5/12/00 RIH to 4501'. Continue to wash over fish. Returns show metal, scale & some formation rock. Wash shoe worn out @ 4502'. POH w/tbg. & tools. LD worn shoe. RIH w/redressed shoe, tools & tbg. Tag @ 4496'. Wash over fish to 4503'. Pull to 4100'.

5/13/00 RIH to 4503'. Wash over fish. Returns metal, scale, some formation rock & cement. Wash shoe worn out @ 4504'. POH w/tbg. tools. LD worn shoe. RIH w/redressed shoe, tools & tbg. Tag @ 4504'. Wash over fish to 4506'. Pull to 4100'.

5/15/00 Tag @ 4506'. Wash over fish to 4507'. Wash shoe worn out. POH w/tbg. & tools. LD shoe. RIH w/4-11/16" overshoe, 2-7/8" catch, 3-3/4" bumper sub, 3-3/4" Johnson jars, 6 3-1/2" DC's & 2-7/8" tbg. Caught fish @ 4507'. Jar fish in too. POH w/2-7/8" tbg. & tools. LD overshot & catch. Fish was 20' 2-7/8" tbg., 2-7/8" collar, 6' more of 2-7/8" crushed tbg. RIH w/redressed shoe, tools & tbg. Tag @ 4501'. Wash over fish to 4503'. Pull to 4100'.

5/16/00 RIH & tag @ 4503'. Wash over fish to 4518'. Fell out. Tag @ 4530'. Wash over to 4534'. POH to 4500'. RIH & tag @ 4518'. POH w/tbg. &

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Mary Jo Turner

TITLE

Production Tech II

DATE

October 18, 2001

TYPE OR PRINT NAME

Mary Jo Turner

(This space for State Use)

APPROVED BY

TITLE

DATE

JAN 2 2002