

DISTRICT I  
1625 French Drive Hobbs, NM 88240

DISTRICT II  
P. O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P. O. Box 2088  
Santa Fe, NM 7504-2088

WELL API NO.  
30-025-33083

5. Indicate Type of Lease  
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.  
B-2148

7. Lease Name or Unit Agreement Name  
Caprock Maljamar Unit

8. Well No.  
175

9. Pool name or Wildcat  
Maljamar Grayburg San Andres

**SUNDRY NOTICES AND REPORTS ON WELLS**

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator  
The Wiser Oil Company

3. Address of Operator  
P.O. Box 2568 Hobbs, New Mexico (505) 392-9797

4. Well Location  
Unit Letter D : 1302 Feet From The North Line and 1367 Feet From The West Line  
Section 19 Township 17S Range 33E NMPM Lea County  
10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
4105' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <u>Temporary Abandon</u> <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

9/03/02 MIRU Eunice Well Service. RIH w/5-1/2" CIBP, 2-3/8" x 4' PS on 2-3/8" work string. Hung CIBP up @ 3900'. RU pump truck. Wash around thru PS & worked loose. POH w/2-3/8" work string. LD 5-1/2" CIBP.

9/04/02 RIH w/4-3/4" bit & 5-1/2" scraper on 2-3/8" tbg. Set down. @ 3920'. Could not work down. POH w/tbg. LD tools. Called Gary Wink @ NMOCD. Obtained approval to set CIBP @ 3900'. RIH w/5-1/2" CIBP on 2-7/8" work string to 3900'. Set CIBP. Test plug to 500#. Held ok. Circulated 105 bbls. pkr. fluid. POH & LD work string. RD BOP. NU WH, 2-7/8" x 6' sub w/valve & gauge on top. RDMO. Will run chart 10/08/02 @ 8:00 a.m. per OCD.

10/08/02 Performed temporary abandon status test w/Gandy Corporation, Nick Jimenez. Witnessed by Mr. Robinson w/NMOCD. Original chart attached. Well is TA'D.

Approval of Temporary  
Abandonment Expires 2/11/08

FEB 2003  
RECEIVED  
Hobbs  
OCD

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE October 29, 2002  
TYPE OR PRINT NAME Mary Jo Turner TELEPHONE NO. (505) 392-9797

(This space for State Use)

APPROVED BY  
CONDITIONS OF APPROVAL, IF ANY:

ORIGINAL SIGNED BY GARY W. WINK TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE FEB 11 2003