Submit 3 Copies		G4-4 CNI-					
to Appropriate		State of New	Mexico				
	En	ergy, Minerals and Na	tural Resources Depar	tment		For	m C-103
District Office			-			Revise	d 1-1-89
DISTRICT I		<b>OIL CONSE</b>	<b>RVATION DIVIS</b>	SION			
PO Box 1980, Hobbs, NM 88241-1980	)		acheco St.		WELLANT	NO	
DISTRICT II			, NM 87505		WELL API		
PO Drawer DD, Artesia, NM 88210		Salla Fe	, 14141 07 50 5			25-33177	
DISTRICT III					5. Indicate T	ype of Lease	<b>—</b>
1000 Rio Brazos Rd., Aztec, NM 8741(	n					STATE X FEE	
110 Drazos INL, AZIOG, INIVI 8741	0				6. State Oil o	& Gas Lease No.	
C!	UNDRY NOTICE	S AND REPORTS ON	IWEIIS			V-1222	
		SALS TO DRILL OR TO D		TO 4			
		R. USE "APPLICATION F		10 A	7. Lease Nat	ne or Unit Agreement Name	
Dir		) FOR SUCH PROPOSAL				<b>Z</b>	
1. Type of Well:	(FORM C-101	JI OK BUCH FRUPUSAL			<sup>r</sup>	Cnowles	
OIL	GAS						
WELL X	WELL		OTHER				
2. Name of Operator	WELL		OTHER				
Primal Energy Corporation					8. Well No.		
3. Address of Operator						1	
211 Highland Cross, Suite #227, Houston, TX 77073					9. Pool name or Wildcat		
4. Well Location	10001, 1A //0/3				Southeas	t Denton - Devonian	
Unit Letter <u>J</u> :	3,627 Feet From T	The N Line	and <u>1,425</u> Feet Fro	an The F			
,,	r ou roll 1	Line	aug <u>1,422</u> Feet Fro	om The <u> </u>	Line		
setion 1	т	nehio 169	Banan 200	17.001		_	
		nship 16S Elevation (Show whether DF, F	Range 38E	NMPM		Lea Coun	ty Mananananananananananananananananananan
			, ,				
· · · · · · · · · · · · · · · · · · ·	Check Ar	3,717' ( propriate Box to Indic		Domont as Off			
NOTICE	OF INTENTION					PORT OF:	
PERFORM REMEDIAL WORK	PL	UG AND ABANDON	REMEDIAL WORK			ALTERING CASING	
TEMPORARILY ABANDON	CI- CI-	IANGE PLANS	COMMENCE DRILL	LING OPNS.		PLUG & ABANDONMENT	Ļ
							لیثا
1. 198 <u>1</u> .			CASING TEST & CE	EMENT JOB	Π		
12. Describe Proposed or Completed O	perations (Clearly state al	pertinent details, and give pert	inent dates, including istimum	- Adde of State and a co	ng-med		
OTHER:							
<ol> <li>Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>Set whipstock and cut with 2. BHA plugged and could at 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site.</li> <li>Cut off wellhead and erection of the set of the set</li></ol>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sidet /01). Pipe stuck and co n 11792 to 11600', W( o 6360', #5 - 30 sx fror oved by Mr. Gary Win . location. Well P&A o	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01.	t 160.57 <sup>0</sup> at 13 permission to 588'. #2 - 25 sx 25 sx from 221	,009'MD (1 P&A (8/31 from 1060 4 to 2100'	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450	
<ol> <li>Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>Set whipstock and cut with 2. BHA plugged and could at 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site.</li> <li>Cut off wellhead and erection of the set of the set</li></ol>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sidet /01). Pipe stuck and co n 11792 to 11600', W( o 6360', #5 - 30 sx fror oved by Mr. Gary Win . location. Well P&A o	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01.	t 160.57 <sup>0</sup> at 13 permission to 588'. #2 - 25 sx 25 sx from 221	,009'MD (1 P&A (8/31 from 1060 4 to 2100'	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450	
<ol> <li>Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>Set whipstock and cut with 2. BHA plugged and could and could and and could and and set of the se</li></ol>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Side (01). Pipe stuck and co n 11792 to 11600', WC o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01.	t 160.57 <sup>0</sup> at 13 permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services.	
<ol> <li>Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>Set whipstock and cut with 2. BHA plugged and could if 3. Set cement plugs as follo from 83220 to 8210', #4 -</li> </ol>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Side (01). Pipe stuck and co n 11792 to 11600', WC o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01.	t 160.57 <sup>0</sup> at 13 permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450	
<ul> <li>12 Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could and could and and an error states and the states of the</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Side (01). Pipe stuck and co n 11792 to 11600', WC o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01.	t 160.57 <sup>0</sup> at 13 permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services.	
<ul> <li>12 Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could and could and and an error states and the states of the</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx from 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Side (01). Pipe stuck and co n 11792 to 11600', WC o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01.	t 160.57 <sup>0</sup> at 13 permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services.	
<ul> <li>12 Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could and could and and could and and set complete the start of the start of</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx from 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and cc n 11792 to 11600', W( o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01.	t 160.57 <sup>0</sup> at 13 permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services.	
<ul> <li>12. Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could and could and and could and and set of the start of the s</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and co n 11792 to 11600', WO o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o the test of my knowledge and TITLE	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01. belief. Manager, Operations and Eng AL SIGNED BY	t 160.57 <sup>0</sup> at 13 permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services.	
<ul> <li>12. Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could if 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site 4. Cut off wellhead and erect thereby certify that the information about stonards.</li> <li>11. Set whipstock and cut with the information about the stonard stonard stonard stonard stonards.</li> <li>12. Describe Proposed or Completed Ower and the stonard stonard stonard stonards.</li> <li>13. Set cement plugs as following the stonard stonard stonard stonard stonard stonard stonard stonard stonards.</li> <li>14. Cut off wellhead and erect stonard stonard</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and cc n 11792 to 11600', W( o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01. belief. Manager, Operations and Eng AL SIGNED BY	t 160.57 <sup>0</sup> at 13 l permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services. DATE <u>9/20/01</u> LEPHONE NO. 281-821-5600	
<ul> <li>12 Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could and could and a set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at set 4. Cut off wellhead and erect and thereby certify that the information about the signament of the set of the set</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and co n 11792 to 11600', WO o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o the test of my knowledge and TITLE	AL SIGNED BY	t 160.57 <sup>0</sup> at 13 l permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs incering	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services. DATE	
<ul> <li>12 Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could if 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site 4. Cut off wellhead and erect thereby certify that the information about the store of the store of</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and co n 11792 to 11600', WO o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o the test of my knowledge and TITLE	tracked well 302.26' at ould not fish. Received DC and tag plug at 115 n 5120 to 4950', #6 - 2 k but were not witness n 9/7/01. belief. Manager, Operations and Eng AL SIGNED BY	t 160.57 <sup>0</sup> at 13 l permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs incering	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services. DATE <u>9/20/01</u> LEPHONE NO. 281-821-5600	
<ul> <li>12 Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could if 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site 4. Cut off wellhead and erect thereby certify that the information about the store of the store of</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and co n 11792 to 11600', WO o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o the test of my knowledge and TITLE	AL SIGNED BY	t 160.57 <sup>0</sup> at 13 l permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs incering	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services. DATE <u>9/20/01</u> LEPHONE NO. 281-821-5600	
<ul> <li>12 Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could if 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site 4. Cut off wellhead and erect thereby certify that the information about the store of the store of</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and co n 11792 to 11600', WO o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o the test of my knowledge and TITLE	AL SIGNED BY	t 160.57 <sup>0</sup> at 13 l permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs incering	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services. DATE <u>9/20/01</u> LEPHONE NO. 281-821-5600	
<ul> <li>12 Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could if 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site 4. Cut off wellhead and erect thereby certify that the information about the store of the store of</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and co n 11792 to 11600', WO o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o the test of my knowledge and TITLE	AL SIGNED BY	t 160.57 <sup>0</sup> at 13 l permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs incering	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services. DATE <u>9/20/01</u> LEPHONE NO. 281-821-5600	
<ul> <li>12. Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could if 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site 4. Cut off wellhead and erect thereby certify that the information about stonards.</li> <li>11. Set whipstock and cut with the information about the stonard stonard stonard stonard stonards.</li> <li>12. Describe Proposed or Completed Ower and the stonard stonard stonard stonards.</li> <li>13. Set cement plugs as following the stonard stonard stonard stonard stonard stonard stonard stonard stonards.</li> <li>14. Cut off wellhead and erect stonard stonard</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and co n 11792 to 11600', WO o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o the test of my knowledge and TITLE	AL SIGNED BY	t 160.57 <sup>0</sup> at 13 l permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs incering	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services. DATE <u>9/20/01</u> LEPHONE NO. 281-821-5600	
<ul> <li>12. Describe Proposed or Completed Owerk) SEE RULE 1103.</li> <li>1. Set whipstock and cut with 2. BHA plugged and could if 3. Set cement plugs as follo from 83220 to 8210', #4 - to 350', and #8 - 10 sx at site 4. Cut off wellhead and erect thereby certify that the information about the store of the store o</li></ul>	indow in 5 1/2' at 1 not circulate (8/24, ows: #1 - 30 sx fror 25 sx from 6460 to surface. Plugs appro- cted marker. Clean	1,690' (8/10/01). Sider /01). Pipe stuck and co n 11792 to 11600', WO o 6360', #5 - 30 sx fror oved by Mr. Gary Win location. Well P&A o the test of my knowledge and TITLE	AL SIGNED BY	t 160.57 <sup>0</sup> at 13 l permission to 588'. #2 - 25 sx 25 sx from 221 sed. All plugs incering	,009'MD (1 P&A (8/31 from 1060 4 to 2100', pumped by TE	/01). 2 to 10490', #3 - 25 sx #7 - 25 sx from 450 BJ Services. DATE <u>9/20/01</u> LEPHONE NO. 281-821-5600	