

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240  
DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210  
DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

RECEIVED  
AUG 27 1998  
OIL CONSERVATION DIVISION  
2040 Pacheco St.  
Santa Fe, NM 87505  
REC - DALLAS

WELL API NO. 30-025-33763
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	7. Lease Name or Unit Agreement Name A. J. #6
2. Name of Operator RAND PAULSON OIL COMPANY INC.	8. Well No. 1
3. Address of Operator 508 W. WALL, SUITE 100, MIDLAND, TX 79701	9. Pool name or Wildcat WILDCAT
4. Well Location Unit Letter <u>R</u> : <u>1980</u> Feet From The <u>EAST</u> Line and <u>1980</u> Feet From The <u>SOUTH</u> Line Section <u>6</u> Township <u>16-S</u> Range <u>35-E</u> NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4055'	

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRU 3/17/98.

1. RIH 2 3/8 - TAG - CIBP W/35' ON TOP - 12,300' CIRC HOLE W/9.5 MUD - PULL TBG TO 10,000' - SPOT 25 SX. PULL TO CLEAN REVERSE OUT.
2. TAG TOC 9880'. POOH W/TBG.
3. CUT 5 1/2 CSG @ 7000'. WOULD NOT PULL. RIH TO 7050'. SPOT 25 SX to 6806'. POOH W/TBG. CUT & PULL 5 1/2 @ 4650'.
4. 5 1/2 STUB @ 4650'. 8 5/8 SHOE @ 4595'. SPOT 75 SX 4700'. TAG TOC 4350'.
5. 35 SX 1600'-1470'. 35 SX 450'-320'.
6. INSTALL 10 SX SURFACE & DRY HOLE MARKER. RDMO 3/24/98.

9.5 BRINE GEL BETWEEN ALL PLUGS.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Harvey J Dupuy Jr TITLE Prod. Mgr. DATE 8/23/98  
TYPE OR PRINT NAME HARVEY J Dupuy Jr TELEPHONE NO.

(This space for State Use)

APPROVED BY Billy E. Krehmer TITLE DATE

CONDITIONS OF APPROVAL, IF ANY: