Submit 3 Copies to Appropriate District Office

State of New Mexico gy, Minerals and Natural Resources Departir

Form C-103

Revised 1-1-89

DISTRICT II P.O. Drawer DD, Artesia, NM 88210 Santa Fe, New Mexico 87504-2088	30-025-34293
	5. Indicate Type of Lease
DISTRICT III	STATE K FEE
1000 Rio Brazos Rd., Aztec, NM 87410	6. State Oil & Gas Lease No. NM 17921
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name
1. Type of Well: OIL OAS WELL X WELL OTHER	State 28
2. Name of Operator	8. Well No.
Hanley Petroleum Inc. 3. Address of Operator	9. Pool name or Wildcat
415 W. Wall, Ste. 1500 Midland, TX 79701	West Lovington Strawn
4. Well Location	
Unit Letter F: 2310 Feet From The North Line and 16	650 Feet From The West Line
Section 28 Township 15S Range 35E	NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
3993 GR	Parada a Otha Para
11. Check Appropriate Box to Indicate Nature of Notice,	, Report, or Other Data JBSEQUENT REPORT OF:
NOTICE OF INTENTION TO:	JBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL	JING OPNS. $oxedsymbol{\square}$ PLUG AND ABANDONMENT $oxedsymbol{\mathbb{X}}$ $ec{ec{X}}$
PULL OR ALTER CASING CASING TEST AND	CEMENT JOB
 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, in work) SEE RULE 1103. 	iciuaing estimatea date of starting any proposed
11-3-98 Notified OCD of plugging. MIRU Mayo Marrs plugging.	ng unit.
11-4-98 Released packer & POOH w/tbg. Set CIBP @ 11,600'.	Ran tbg & put 35' of cmt on plug
circ hole w/10# mud. Set cmt plug from 8139-8039' 11-5-98 POOH w/tbg. Found casing free @ 6800'. Shot csg casing.	
11-6-98 Finished laying down 154 jts 4 1/2" casing. Ran t	tbg to 6850' and pumped 25 sx plug.
11-9-98 Tagged plug @ 6728'. Set 45 sx plug @ 4750'. Set @ 475'. Set 20 sx plug from 50' to surface. Cut	t 40 sx plug @ 2021'. Set 50 sx pl
permanent marker.	
11-16-98 Restored surface location.	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
SKONATURE VP Engine	eering
SKINATURE	DATE
TYPEOR PRINT NAME Greg Wilkes	TELEPHONE NO. 684-8051
(This space for State Use)	Men in the
$(\mathcal{L}^{*}_{\mathcal{A}})_{\mathcal{A}}$	and the second of the second o