

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO.

30-025-34616

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

24566

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

7. Lease Name or Unit Agreement Name

Townsend "3" State

1. Type of Well:

OIL WELL ☐ GAS WELL ☐ OTHER ☐ Temporarily Abandoned

2. Name of Operator

Ocean Energy Resources, Inc.

3. Address of Operator

4305 N. Garfield, Suite 200A, Midland, Texas 79705

4. Well Location

Unit Letter N 660 Feet From The South Line and 2310 Feet From The West Line

Section 3 Township 16-S Range 35-E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4011 GR

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent date, including estimated date of starting any proposed work).
SEE RULE 1103.

1. MRL workover rig
2. RHH w/ tbg and retrieve RBP @ 4515'
3. RHH w/ tbg and tag ID @ 11720' Circ hole w/ 100 brine w/ 25# gel dbbl.
4. POOH to 11620', spot 130 sx cement from 11620' to 11392'.
5. WOC and tag plug @ 11,392'.
6. Spot 70 sx cement plug @ 9595' to 9395'
7. Spot 50 sx cement plugs @ 7619' to 7419', 6500' to 6300'.
8. Spot 25 sx intermediate shoe plug from 4782' to 4682'.
9. WOC and tag plug @ 4682'.
10. Spot 35 sx cement plug from 1785' to 1685'
11. Spot 35 sx surface shoe plug from 370' to 470'
12. WOC and tag plug @ 365'
13. Spot 20 sx surface plug from 0' to 60'
14. Circulate 4 sx to pit
15. Cut off wellhead and weld on dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Janice Holley

TITLE Production Analyst

DATE 06/15/00

TYPE OR PRINT NAME Janice Holley

TELEPHONE NO. (915) 683-3003

(This space for State Use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

GWV

df