

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-34662
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	GREEN STAR 14 STATE COM
8. Well No.	1
9. Pool Name or Wildcat	Wildcat ANDERSON RANCH QUEEN
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4289'

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>N</u> : <u>660</u> Feet From The <u>SOUTH</u> Line and <u>2310</u> Feet From The <u>WEST</u> Line Section <u>14</u> Township <u>16-S</u> Range <u>32-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4289'

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐ COMPLETE TO QUEEN ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-04-00: MIRU. NUSEAT PMP.
4-05-00: KILL W/30 BBLS 2% KCL DN CSG. NDWH. NUBOP. TBG SET @ 10,529'. TIH W/BIT & CSG SCRAPER TO 6267'.
4-06-00: PMP 20 BBLS 2% DN CSG & 10 BBLS DN TBG. TIH W/BIT & SCRAPER TO 9940'. TIH W/CIBP & SET @ 9565'. TIH W/CMT BAILER & DUMP 35' CMT ON TOP OF CIBP.
4-07-00: TIH W/LOGGING TOOL. TIH W/GR/CCL/CBL. PRESS CSG TO 500#-OK. LOG FR 4650-2780'. CMT TOP @ 2984'.
4-10-00: TIH W/SN TO 9500'. TEST & CHART CSG & CIBP FOR NMOC. DISPL W/120 BBLS 10# BRINE. DISPL W/35 BBLS 2% KCL WTR.
4-11-00: TIH W/CIBP & TAG @ 1360'. TIH W/BIT & SCRAPER TO 4610'. TIH W/CIBP SET @ 4555'. TIH W/CMT BAILER & DUMP 100'CMT ON TOP OF CIBP. NEW PBD 4455'. TIH W/CSG GUN & PERF 3730-54. TIH W/FAC PKR, SN ON TBG. TEST TO 8500#. SET PKR @ 3638'. LOAD & TEST BACKSIDE TO 1000#-OK.
4-12-00: PRESS CSG TO 500#-OK. ACIDIZE QUEEN PERFS 3730-54 W/1500 GALS 15% NEFE HCL. RU SWAB. FL @ SURF.
4-13-00: FL @ 3300'. NO OIL OR GAS SHOW. END FL-SWAB DRY. RD SWAB. LOWER PKR TO 3800'. RESET PKR @ 3638'.
4-14-00: FL @ 1300'. FRAC QUEEN PERFS 3730-54 W/30,000 GALS 30# X-LINKED GEL. FLISH TO TOP PERF.
4-17-00: fl @ surf. End fl @ 2300'.
4-18-00: REL PKR. TIH W/COLLAR & BAILER ON TBG. TAG FILL @ 3670-60'. C/O FRAC SAND RO 4454-PBD. TIH W/PERF SUB W/BULL PLUG, SN ON TBG. TBG @ 3590-220' ABOVE TOP PERF.
4-19-00: END FL @ 3000'.
4-20-00: RD SWAB.
4-21-00: RU SWAB. FL @ 3000'. END FL @ 3200'.
4-24-00: LOWER SN TO 3665'. PULL SN BACK TO 3500'. END FL @ 3200'.
4-25-00: LOWER TBG & TAG FILL @ 3730'. TIH W/COLLAR. C/O FRAC SD 3730-4454-PBD. TIH W/PKR, SN. SET PKR @ 3638'. LOAD & TEST BACKSIDE TO 500#-OK.
4-26-00: MIX & PUMP 8 BBLS 2% KCL WTR.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 6/26/00
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED _____ TITLE CHIEF DATE _____
CONDITIONS OF APPROVAL IF ANY: _____

2A Anderson Ranch Wolfcamp