

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL AP. NO.	30-025-35109
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	GREEN STAR "22" STATE
8. Well No.	1
9. Pool Name or Wildcat	ANDERSON RANCH WOLFCAMP

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well.	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>G</u> : <u>1980</u> Feet From The <u>NORTH</u> Line and <u>2310</u> Feet From The <u>EAST</u> Line Section <u>22</u> Township <u>16-S</u> Range <u>32-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4312'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☒
TEMPORARILY ABANDON ☐	COMMENCE DRILLING OPERATION ☐
PULL OR ALTER CASING ☐	CASING TEST AND CEMENT JOB ☐
OTHER: ☐	OTHER: ☐
PLUG AND ABANDON ☐	ALTERING CASING ☐
CHANGE PLANS ☐	PLUG AND ABANDONMENT ☐
	FINAL DATA - COMPLETION ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-01-00/12-08-00: PUMPING & TESTING. EVALUATE OTHER PAY ZONES.

2-13-01: ND TREE & NUBOP.

2-14-01: PU BAKER LOCK SET BP. SET @ 9300 ON 301 JTS 2 7/8" TBG. LOAD HLE W/190 BBLS 2% KCL WTR.

2-15-01: RUWL. TIH W/DUMP BAILER. TAG RBP @ 9296'. DUMP 20' SAND ON RBP. RU PUMP TRUCK. RUN PERF DEPTH CONTROL LOG FR 9280-7400. PERF WOLFCAMP UNDER LUBRICATOR FR 9159-9183. TIH W/PROF NIPPLE, 2 7/8" TBG, PKR TO 9172'.

2-17-01: INSTL POP OFF ON CSG SET @ 2750'. SPOT 100 GALS 15% HCL FR 9172-9053. PULL PKR TO 9077. TBG @ 9141. SET PKR @ 9077'. NDBOP. NU FRAC TREE & TREE SAVER. TEST LINES TO 11,000. ACIDIZE WOLFCAMP PERFS 9159-9183 W/2300 GALS 15% HCL. START FLOW BACCK FOR 3 HRS. RU SWAB.

2-18/2-20-01: SWABBING. ND FRAC TREE. NUBOP. REL PKR. TIH W/296 JTS 2 7/8" TBG TO 9140. SET RBP @ 9140.

2-21-01: LOAD CSG W/75 BBLS 2% KCL. TEST CSG & RBP TO 2000 PSI. TEST OK. RUWL. TIH W/DUMP BAILER. TAG RBP @ 9140. DUMP 10' SAND ON RBP. PERF WOLFCAMP UNDER LUBRICATOR FR 9113-9096, 9086-9080. TIH W/PROF NIPPLE, TBG, PKR TO 9112.

2-23-01: SPOT 100 GALS 15% HCL FR 9112-9010. SET PKR @ 8986'. TP @ 9049. NDBOP. NU FRAC TREE. ACIDIZE WOLFCAMP PERFS 9080-9113 W/2300 GALS 15% HCL. FLOWING BACK FOR 2 HRS.

2-24-01: TAG FLUID @ 3500. SWABBING.

2-27-01: ND FRAC TREE. NUBOP. L REL PKR. PU RETR TOOL. TIH W/282 JTS 2 7/8" TBG. TAG SAND @ 9133. BAIL OUT SAND TO 9140.

2-28-01: TIH W/2 7/8" TBG TO 9140. LATCH ON RBP. REL RBP. TIH W/KILL STRING.

3-01-01: INSTL 3 1/2" PIPE RAMS IN BOP. PU WL ENTRY GUIDE, TBG, PKR. PU 3 1/2" TBG.

3-02-01: PU TBG TO 9000'. PSA 9000'. 20 PTS COMPRESSION. TP @ 9034. NDBOP. NU FRAC TREE. ACID FRAC WOLFCAMP PERFS 9080-9183 W/14,000 GALS WF130 & 20,000 GALS 20% HCL. START FLOWING BACK.

3-07-01: ND FRAC TREE. NUBOP. REL PKR.

3-08-01: INSTL PIPE RAMS. TIH W/20 JTS 2 7/8" TBG. LD SAME. TIH W/3 1/2" MA, SN, TBG, TAC. MA @ 9219. SN @ 9194. TAC @ 8978. NDBOP. SET TAC @ 8978 W/15 PTS TENSION. NUWH.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 4/4/01

TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED _____

CONDITIONS OF APPROVAL IF ANY: _____ TITLE _____ DATE _____

3-09-01: TIH W/GAS ANCHOR, PUMP, RDS. SPACE OUT RDS. HANG WELL ON. LOAD TBG W/15 BBLS FW. TEST TBG TO 500 PSI. RIG DOWN KEY UNIT. CLN LOCATION.

3-10/3-16-01: PUMPING AND TESTING.

3-17-01: MIRU KEY UNIT #341. NDWH. LD RDS & PMP.

3-18-01: REL TAC. NUBOP. TOH W/TBG & TAC.

3-20-01: TIH W/RETR HEAD. TBG SUB, TBG PMP. TAG SAND @ 9280'. RU PUMP TRUCK. LOAD HLE W/60 BBLS WOLFCAMP PROD WTR. BAIL SAND FR 9280-9300'. TIH W/RETR TOOL & 301 JTS 2 7/8" TBG TO 9300'. LATCH ON RBP. REL RBP.

3-21-01: PU MA, SN & TBG. TIH W/TBG, TAC. MA @ 9828. SN @ 9803.54'. TAC @ 8978.06. NDBOP. NU7WH. SET TAC W/15 PTS TENSION. PU GAS ANCHOR, PMP, RDS.

3-22-01: SPACE OUT RDS. HANG WELL ON. LOAD TBG W/35 BBLS PROD WTR. PRESS TEST TBG TO 600 PSI. TEST OK. RETRN TO PROD.

3-23/3-28-01: PUMPING AND TESTING.

3-29-01: ON 24 HR OPT. PUMPED 13 BO, 17 BW, & 27 MCF.

WOLFCAMP PERFS: 9752-9767', 9159-9183', 9080-9086', 9096-9113'

FINAL REPORT