

NO. OF COPIES RECEIVED	
DISTRIBUTION	
ANTA FE	
ILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDARY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR NOTICES TO ABANDON OR TO PERFORM OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR REPORT ON (FORM C-101) FOR SUCH PROPOSALS.)		5a. Indicate Type of Lease State ☒ Fee ☐ 5. State Oil & Gas Lease No. E-2439
OIL WELL ☐ GAS WELL ☐ OTHER- Water Injection Well Name of Operator Murphy H. Baxter Address of Operator P. O. Box 2040 Midland, Texas 79702 Location of Well UNIT LETTER A 660 FEET FROM THE North LINE AND 660 FEET FROM THE East LINE, SECTION 1 TOWNSHIP 18S RANGE 33E NMPM.		7. Unit Agreement Name N. EK Queen Unit 8. Farm or Lease Name Tract 2 9. Well No. 3 10. Field and Pool, or Wildcat EK Yates 7 Rivers Quee
15. Elevation (Show whether DF, RT, CR, etc.)		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ TEMPORARILY ABANDON ☐ PULL OR ALTER CASING ☐ OTHER ☐	SUBSEQUENT REPORT OF: PLUG AND ABANDON ☐ CHANGE PLANS ☐ OTHER ☐ REMEDIAL WORK ☐ COMMENCE DRILLING OPNS. ☐ CASING TEST AND CEMENT JOBS ☐ OTHER ☐ ALTERING CASING ☐ PLUG AND ABANDONMENT ☐

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Pull out of hole with production equipment.
2. Rig up wireline, run 4½" CIBP to 3757' and tag. Pull to 3710' and set plug. Pull out of hole with wireline.
3. Rig up casing equipment. Try to pull slips. Cannot unseat.
4. Run in hole with tubing. Tag CIBP @ 3757'. Spot 10 sks. of cement on top of CIBP. Circulate to surface with brine gel. Pull out of hole with tubing. Rig up wireline.
5. Perforate @ 1700'. Run in hole with packer. Injection rate. Run in hole with tubing @ 1700'. Spot 70 sks. of cement. Pull out of hole with tubing. Pack off wellhead. Pump 4 BBL.. Squeeze @ 500 PSI. Test plug @ 500 PSI. Tag plug @ 1570' Circulate casing with mud.
6. Cut off wellhead. Set 10sk. surface plug. Install P & A Marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
SIGNED Baber Well Serv. P&A Supv.	DATE 10-28-87
APPROVED BY OIL & GAS INSPECTOR	DATE MAY 2 1989
CONDITIONS OF APPROVAL, IF ANY:	

E