

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance  
Workovers, Expense DD's, PL's, and Conversions

Lease: E. K. Queen Unit Well No. 6-3  
Field: E. K. Yates Seven Rivers Queen  
County: Lea State: New Mexico

RECOMMENDED PROCEDURE:

1. Move in casing pulling unit and pull down-hole equipment.
2. Run 2" tubing to 4351' and spot 35 sx cement plug.
3. Circulate hole to mud laden fluid.
4. Determine free point of 5 1/2" csg. Cut off csg. & pull (+ 3000').
5. Spot 25 sx cement plug across Cut off point.
6. Spot 35 sx cement plug at bottom of 8 5/8" csg. @ 1638' (1588' - 1688')
7. Spot 10 sx cement plug at surface.
8. Cut off well head and install marker.