

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: Bridges State Well No. 81
Field: Vacuum
County: Lea State: New Mexico

RECOMMENDED PROCEDURE:

- * 1. ~~Spot 150' cement plug (30 sx) from 3849' to 3999'.~~
Set cement retainer at 3820. Squeeze with 200 sx.
2. Circulate hole to mud laden fluid (mud should consist of 25 sx of gel per 100 bbls of water).
3. Cut and pull 5 1/2" casing (estimated recovery 250'). Set 100' cement plug (50' above and 50' below) cut-off point (30 sx).
4. Spot 10 sx of cement plug at surface.
5. Cut off wellhead and install marker.

* Revised procedure recommended because of known pressure problem in area. Higher pressure on annulus. This has been discussed with Don Elliot.

NOTE: Verbally approved by NMOCC

ARA:RCL/mw
12/12/72