

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: Bridges State Well No. 1
Field: Vacuum-San Andres Flood
County: Lea State: New Mexico

RECOMMENDED PROCEDURE:

1. Run 2" tbg w/ cement retainer. Set retainer at 4450' and squeeze San Andres perms (4586'-4644').
2. Spot 60 sx cement plug from 4200' to 4450'.
3. Circulate hole to mud laden fluid.
4. Spot 35 sx cement plug. From 1550' to 1650'.
5. Spot 10 sx cement plug at surface.
6. Cut off well head and install marker.