

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised March 25, 1999

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
DISTRICT II
811 South First, Artesia NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410
DISTRICT IV
2040 South Pacheco, Santa Fe, NM 87505

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-02037

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
B-1520

7. Lease Name or Unit Agreement Name

Bridges State

8. Well No.

62

9. Pool name or Wildcat

Vacuum; Grayburg-San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:

Oil
Well ☐

Gas
Well ☐

Other **Injector**

2. Name of Operator

Mobil Producing TX. & N.M. Inc.

3. Address of Operator **P.O. Box 4358**

Houston

TX 77210-4358

4. Well Location

Unit Letter **M** **660** Feet From The **south** Line and **660** Feet From The **west** Line

Section **14**

Township **17S**

Range **34E**

NMPH

Lea

County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
4048 gr

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG & ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: **Temporarily Abandon** ☒

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. (For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion)

8/12/02 Inspected rig and checked H2S monitor. Waited for rig anchors to be tested. MIRU WSU. Waited 4 hrs for screw-on wellhead to arrive. Unflanged wellhead. Installed BOP and tested, ok. Worked with packer 1 hr before it released. POOH with one joint tubing. SIFN.

8/13/02 Inspected rig and checked H2S monitor. Opened well up, no psi. Circulated clean with 160 bbls 10 ppg brine. POOH with tubing and Baker Model AD-1 packer. RU WLU. RIH with gauge ring to 4100', ok. POOH, RIH with CIBP, set at 4090'. Dumped 35' cement on top. POOH, RDMO WLU. RIH with 129 joints open ended tubing to cement top.

~~This Approval of Temporary
Abandonment Expires~~

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Tiffany Stebbins TITLE **Staff Office Assistant**

DATE **08/30/2002**

TYPE OR PRINT NAME **Tiffany A. Stebbins**

TELEPHONE NO. **(713) 431-1207**

(This space for State Use)

APPROVED BY _____
CONDITIONS OF APPROVAL IF ANY:

ORIGINAL SIGNED BY
GARY W. WINK
OFFICE FIELD REPRESENTATIVE II/STAFF MANAGER

SEP 04 2002