State of New Mexico

oubmit 3 copies of Appropriate Energy, dinerals and Natural Resources Department	Form C-103	
District Office	Revised 1-1-89	
P.O. Roy 1980 Hobbs, NM 88240		
DISTRICT II	5-02252	
P.O. Box Drawer DD, Artesia, NM 88210 Santa Fe, New Mexico 87504-2088 5. Indicate Type of Lease	STATE TEE	
DISTRICT III 6. State Oil / Gas Lease N		
1000 Rio Brazos Rd., Aztec, NM 87410	B-1080	
SUNDRY NOTICES AND REPORTS ON WELL (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.) 7. Lease Name or Unit A VACUUM GRAYBURG	_	
1. Type of Well: OIL GAS WELL OTHER		
2. Name of Operator TEXACO EXPLORATION & PRODUCTION INC. 8. Well No. 40		
3. Address of Operator P.O. BOX 730, HOBBS, NM 88240 9. Pool Name or Wildcat VACUUM GRAYI	BURG SAN ANDRES	
4. Well Location		
Unit Letter <u>E: 1980</u> Feet From The <u>NORTH</u> Line and <u>660</u> Feet From The <u>WEST</u> Line		
Section 1 Township 18S Range 34E NMPM LEA COUNTY		
10. Elevation (Show whether DF, RKB, RT,GR, etc.) 4008' DF		
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data		
NOTICE OF INTENTION TO: SUBSEQUENT RE	PORT OF	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERIN	IG CASING	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERIN TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AN		
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERIN	IG CASING	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND CASING TEST AND CEMENT JOB	NG CASING	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND PULL OR ALTER CASING CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date	NG CASING	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING TEMPORARILY ABANDON CHANGE PLANS CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date work) SEE RULE 1103.	OF Starting any proposed	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND CASING TEST AND CEMENT JOB CONTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date work) SEE RULE 1103. 1/2/95 - 1/6/95 1. MIRU, TOH W/ RODS & PMP. KILLED WELL, INSTALLED BOP, & TOH W/ TBG. TIH W/ TP, PKR, & TBG. SPTD 1000 G/	of starting any proposed ALS AMMONIUM	
PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND PULL OR ALTER CASING CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date work) SEE RULE 1103. 1/2/95 - 1/6/95 1. MIRU, TOH W/ RODS & PMP. KILLED WELL, INSTALLED BOP, & TOH W/ TBG. TIH W/ TP, PKR, & TBG. SPTD 1000 G/BICARBONATE @ 4700'. SION. 2. SET PKR @ 3408', LOADED AND TESTED BS, HELD OK. ACIDIZED OPEN HOLE FROM 4076'-4710' W/ 15,600 GALS 150'.	of starting any proposed ALS AMMONIUM	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date work) SEE RULE 1103. 1/2/95 - 1/6/95 1. MIRU, TOH W/ RODS & PMP. KILLED WELL, INSTALLED BOP, & TOH W/ TBG. TIH W/ TP, PKR, & TBG. SPTD 1000 G/BICARBONATE @ 4700'. SION. 2. SET PKR @ 3408', LOADED AND TESTED BS, HELD OK. ACIDIZED OPEN HOLE FROM 4076'-4710' W/ 15,600 GALS 150 SI 1 HR & SWABBED BACK.	of starting any proposed ALS AMMONIUM	
PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND PULL OR ALTER CASING CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date work) SEE RULE 1103. 1/2/95 - 1/6/95 1. MIRU, TOH W/ RODS & PMP. KILLED WELL, INSTALLED BOP, & TOH W/ TBG. TIH W/ TP, PKR, & TBG. SPTD 1000 G/BICARBONATE @ 4700'. SION. 2. SET PKR @ 3408', LOADED AND TESTED BS, HELD OK. ACIDIZED OPEN HOLE FROM 4076'-4710' W/ 15,600 GALS 150 SI 1 HR & SWABBED BACK. 3. SCALE SQZD W/ 2 DRUMS TH-793 IN 24 BFW, OVERFLUSHED W/ 200 BFW. SION.	of starting any proposed ALS AMMONIUM	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date work) SEE RULE 1103. 1/2/95 - 1/6/95 1. MIRU, TOH W/ RODS & PMP. KILLED WELL, INSTALLED BOP, & TOH W/ TBG. TIH W/ TP, PKR, & TBG. SPTD 1000 G/BICARBONATE @ 4700'. SION. 2. SET PKR @ 3408', LOADED AND TESTED BS, HELD OK. ACIDIZED OPEN HOLE FROM 4076'-4710' W/ 15,600 GALS 150 SI 1 HR & SWABBED BACK. 3. SCALE SQZD W/ 2 DRUMS TH-793 IN 24 BFW, OVERFLUSHED W/ 200 BFW. SION. 4. TOH W/ PKR. TIH W/ RODS, PMP, & TBG. RETURNED WELL TO PRODUCTION.	of starting any proposed ALS AMMONIUM	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date work) SEE RULE 1103. 1/2/95 - 1/6/95 1. MIRU, TOH W/ RODS & PMP. KILLED WELL, INSTALLED BOP, & TOH W/ TBG. TIH W/ TP, PKR, & TBG. SPTD 1000 G/BICARBONATE @ 4700'. SION. 2. SET PKR @ 3408', LOADED AND TESTED BS, HELD OK. ACIDIZED OPEN HOLE FROM 4076'-4710' W/ 15,600 GALS 150 SI 1 HR & SWABBED BACK. 3. SCALE SQZD W/ 2 DRUMS TH-793 IN 24 BFW, OVERFLUSHED W/ 200 BFW. SION. 4. TOH W/ PKR. TIH W/ RODS, PMP, & TBG. RETURNED WELL TO PRODUCTION.	of starting any proposed ALS AMMONIUM	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date work) SEE RULE 1103. 1/2/95 - 1/6/95 1. MIRU, TOH W/ RODS & PMP. KILLED WELL, INSTALLED BOP, & TOH W/ TBG. TIH W/ TP, PKR, & TBG. SPTD 1000 G/BICARBONATE @ 4700'. SION. 2. SET PKR @ 3408', LOADED AND TESTED BS, HELD OK. ACIDIZED OPEN HOLE FROM 4076'-4710' W/ 15,600 GALS 150 SI 1 HR & SWABBED BACK. 3. SCALE SQZD W/ 2 DRUMS TH-793 IN 24 BFW, OVERFLUSHED W/ 200 BFW. SION. 4. TOH W/ PKR. TIH W/ RODS, PMP, & TBG. RETURNED WELL TO PRODUCTION.	of starting any proposed ALS AMMONIUM	

Thereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE That Complete to the best of my knowledge and belief. DATE 1/30/95		
TYPE OR PRINT NAME	Monte C. Duncan	Telephone No. 397-0418
(This space for State Use)		FEB 0.1 1995
APPROVED BY	BE NEET SUPERVISORLE	DATE
CONDITIONS OF APPROVAL, II		

DeSoto/Nichols 10-94 ver 2.0