

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-101
• Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR APPLICATION TO OIL OR GAS WELL OR FOR WELL BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT NO. (FORM C-101) FOR SUCH PURPOSES.)		5a. Indicate Type of Lease State ☒ Fee ☐ 5. State Oil & Gas Lease No. E -8714																
1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER Water Injection Well 2. Name of Operator Murphy H. Baxter 3. Address of Operator P. O. Box 2049 Midland, Texas 79702 4. Location of Well UNIT LETTER A 330 FEET FROM THE North LINE AND 660 FEET FROM THE East LINE, SECTION 7 TOWNSHIP 18S RANGE 34E NMPM.	7. Unit Agreement Name N. EK Queen Unit 8. Farm or Lease Name Tract 4 9. Well No. 6 10. Field and Pool, or Wildcat E.K. Yates 7 Rivers Qu																	
15. Elevation (Show whether DF, RT, GR, etc.) 4087 GR		12. County Lea																
16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data <table border="0"> <tr> <td colspan="2">NOTICE OF INTENTION TO:</td> <td colspan="2">SUBSEQUENT REPORT OF:</td> </tr> <tr> <td>PERFORM REMEDIAL WORK ☐</td> <td>PLUG AND ABANDON ☒</td> <td>REMEDIAL WORK ☐</td> <td>ALTERING CASING ☐</td> </tr> <tr> <td>TEMPORARILY ABANDON ☐</td> <td>CHANGE PLANS ☐</td> <td>COMMENCE DRILLING OPHS. ☐</td> <td>PLUG AND ABANDONMENT ☐</td> </tr> <tr> <td>PULL OR ALTER CASING ☐</td> <td>OTHER ☐</td> <td>CASING TEST AND CEMENT JOBS ☐</td> <td></td> </tr> </table>			NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:		PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐	TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPHS. ☐	PLUG AND ABANDONMENT ☐	PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:																
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐															
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPHS. ☐	PLUG AND ABANDONMENT ☐															
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐																
17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.																		

*Commission will be notified 24 hrs. prior to commencing work.

1. Trip in hole with CIBP. Set CIBP. @ 4250'.
2. Spot 35' of cement on top of CIBP.
3. Displace hole with mud-laden fluid. Close pipe rams. Test plug and casing to 500#'s.
4. Perforate 4 holes @ 1700'. (Top of anhydrite @ 1728') Circulate or squeeze 50 sks. or sufficient cement to isolate anhydrite section.
5. Tag plug and test to 500#'s.
6. Spot cement 50' above and below surface casing shoe @ 332'. WOC.
7. Tag plug. Cut off bradenhead and weld steel plate on casing. Set P & A marker.

10 sack surface plug

I, hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Chuck Sledge **Chuck Sledge** TITLE Petroleum Engineer DATE 8-13-87

APPROVED BY Paul Kautz **Paul Kautz** TITLE Geologist DATE AUG 24 1987

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
AUG 24 1997
SCLD
HARRIS OFFICE