

12) continued

- 5) Spot 25 sxs cement plug from 2215 to 1975 ft. ( 50 ft. above top of salt )
- 6) Spot mud from 1975 to 491 ft.
- 7) POOH w/ tubing work string. RIH and cut 5 ½" casing at 491 ft. ( this is 50 ft. below the 8 5/8" casing shoe at 441 ft. ). POOH w/ 5 ½" casing.
- 8) RIH w/ tubing work string and spot cement from 491 ft. to the surface. ( 133 sxs cement )
- 9) Cut off 8 5/8" casing 3 ft. below ground level.
- 10) Regulatory marker to be set in cement over wellbore.