

14. POOH & LD to 383'. If casing stub is below 308', LD WS to 50' inside casing stub. Spot Plug No. 8, minimum 260 sx., minimum interval: 358' or 50' inside casing stub (whichever is deeper)-surface, calculated interval: 383'-surface. WOC. Visually tag cement and top off if necessary.
15. Cut off casing and wellhead 3' below GL and cap well. Install dry hole marker. Perform reclamation work.
16. Send forms and reports to:
Phillips Regulatory
4001 Penbrook
Odessa, Texas 79762