

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

L CONSERVATION DIVISIO

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Union Oil Company of California	8. Farm or Lease Name Reeves "A" 26
3. Address of Operator P. O. Box 671 Midland, Texas 79702	9. Well No. 4
4. Location of Well UNIT LETTER <u>K</u> <u>1654</u> FEET FROM THE <u>South</u> LINE AND <u>1654</u> FEET FROM THE <u>West</u> LINE, SECTION <u>26</u> TOWNSHIP <u>18-S</u> RANGE <u>35-E</u> N.M.P.M.	10. Field and Pool, or Wildcat Undes. Bone Springs
15. Elevation (Show whether DF, RT, GR, etc.) 3861' GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐	ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOBS ☐	
OTHER ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 12-27-84 - MIRU PU Install BOP. POOH w/tbg & pump
 12-29-84 - RIH w/5-1/2" CIBP on tbg & set @ 8772'. Circ. hole clean w/10 ppg gelled wtr
 Spot 20 sx cmt on CIBP 8772' - 8569' PLUG NO. 1 ND BOP & well head. Weld
 on pull nipple to 5-1/2" csg.
 1- 1-85 - Free slips - run free point test. Cut csg @ 5328' & POOH w/5-1/2" csg (5279')
 1- 3-85 - RD csg jacks. Install BOP. RIH w/tbg OE'd & spot 40 sx cmt across 5-1/2"
 csg stub 5370' - 5250' PLUG NO. 2.
 1-4-85 - PU & spot 35 sx cmt plug 5090' - 4953' PLUG NO. 3 . PU & spot 35 sx cmt
 3860' - 3745' PLUG NO. 4. PU & spot 45 sx cmt plug 1800' - 1626' PLUG NO. 5
 PU & spot 45 sx cmt plug 455' - 281' PLUG NO. 6.
 1- 5-85 - Spot 10 sx cmt plug 39' to surface PLUG NO. 7 . Cut off WH 3' BGL. Weld
 on P&A plate & dry hole marker. Well P&A 1-5-85.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. R. Hughes TITLE Dist. Drlg. Supt. DATE 1-18-85
R. A. Adair OIL & GAS INSPECTOR
 APPROVED BY R. A. Adair TITLE OIL & GAS INSPECTOR DATE 5-6-85
 CONDITIONS OF APPROVAL, IF ANY: