

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: State Section 27 Well No. 2

Field: Vacuum Bone Springs South

County: Lea State: New Mexico

RECOMMENDED PROCEDURE:

- 1) Pull rods, pump, & tbg (Warehouse rods)
- 2) Run cement retainer on tbg to top of Bone Springs perts.
- 3) Squeeze perts and cap retainer
- 4) Circulate hole to mud laden fluid and POTH
- 5) Cutoff and pull free 7" Csg
- 6) Cutoff and pull free 9 $\frac{5}{8}$ " Csg
- 7) Run tbg 50' below cutoff of 7" csg and spot 30 sx plug
- 8) Pull tbg to 50' below 9 $\frac{5}{8}$ " cutoff and spot 50 sx plug.
- 9) Spot 10 sx plug at surface
- 10) Remove Wellhead and install marker

DIAO 3/4/69