

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-75

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO SEEPER OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT -- (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☐ OTHER INJECTOR

7. Unit Agreement Name
N. HOBBS (G/SA) UNIT

Name of Operator
SHELL WESTERN E&P INC.

8. Field or Lease Name
SECTION 24

Address of Operator
P. O. BOX 576, HOUSTON, TEXAS 77001 (WCK 4435)

9. Well No.
311

Location of Well
UNIT LETTER B 660 FEET FROM THE NORTH LINE AND 1980 FEET FROM THE EAST LINE, SECTION 24 TOWNSHIP 18-S RANGE 37-E

10. Field and Pool, or Whence
HOBBS (G/SA)

15. Elevation (Show whether DF, RT, GR, etc.)
3674' DF

12. County
LEA

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER PERF, ACIDIZE & SQZ ☒

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☒

REMEDIAL WORK ☐
COMMENCE DRILLING OPER. ☐
CASING TEST AND CEMENT JOB ☐
ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work; SEE RULE 1103.

1. Pull inj equip.
2. CO to 4275' (PBTD).
3. Run csg inspection log 4000' - 4275'.
4. Perf San Andres 4200' - 4230' (2 JSPF, 60 holes).
5. Set RBP @ 4260'. Acidize perfs 4252' - 4256' w/500 gals 15% HCl.
6. Reset RBP @ 4240'. Acidize perfs 4200' - 4230' w/3000 gals 15% HCl. POH w/RBP.
7. Run base/GR log from 4000' - 4275'.
8. PB to 4195' w/approx. 750# sand. Cap w/10' cmt.
9. Set CIBC @ 4095'.
10. Sqz San Andres perfs 4132' - 4186' w/100 sx Cls "C" cmt + 2% CaCl₂ + 1.5% Howco suds + 0.75% HC-2. WOC 24 hrs.
11. DO CIBC & cmt to 4190'. Pres tst sqz to 700# for 15 min.
12. DO CIBC @ 4195'. CO to PBTD.
13. Run base/GR log from 4000' - 4275'.
14. Install inj equip & return well to inj.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed A. J. FORE TITLE SUPERVISOR REG. & PERMITTING DATE FEBRUARY 17, 1987

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

TITLE DATE FEB 20 1987

RECEIVED
FEB 19 1987
OCD
HOBBS OFFICE