

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.

A-3071

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Conoco Inc.	8. Farm or Lease Name State G-G-30
3. Address of Operator P.O. Box 460 - Hobbs, New Mexico 88240	9. Well No. No 1
4. Location of Well UNIT LETTER <u>K</u> , <u>2310</u> FEET FROM THE <u>South</u> LINE AND <u>1650</u> FEET FROM THE <u>West</u> LINE, SECTION <u>30</u> TOWNSHIP <u>18S</u> RANGE <u>37E</u> NMPM.	10. Field and Pool, or Wildcat Goodwin/Drinkard
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRU. Go in hole w/gauge ring & junk basket to 7100'. POOH. Go in hole w/5 1/2" CIBP and set at 7050' (isolate Drinkard perf). Go in hole w/dump bailer & spot 35' of cement on top of CIBP. Go in hole w/5 1/2" CIBP set at 6580 (isolate top of Drinkard) Go in hole w/dump bailer & spot 35' of cement on CIBP. POOH. Go in hole w/2 1/2" ts 2 3/8" TBG to 6520'. Circ w/ 151 bbls 9.5 ppq mud (25 sxs salt gel/100 bbl 9 ppq brine) POOH w/TBG. Spot 2 bbl 10% Acetic acid from 3150'-3066'. Perf w/4 spf at 3150'. Pump 9.5 ppq mud down 5 1/2" csq & establish circulation. Pump 500 sxs class "C" neat cement mixed at 14.8 ppq down 5 1/2" csq & flush cement to 3050' w/70 bbl mud. Wait on cement. Tag cement at 2938'. POOH w/TBG. Spot 25 sxs class "C" neat from 1592'-1342'. POOH w/TBG. Go in hole &

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED DF FINNEY TITLE Administrative Supervisor DATE September 10, 1988

APPROVED BY [Signature] OIL & GAS INSPECTOR DATE OCT 28 1987