State of New Mexico

Form C-103

--- DATE ----

OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088 Santa Fe, New Mexico 97504-2088 Santa Fe, New Mexico 9750	to Appropriate District Office	Energy, Minerals and Natural Res	sources Department	Revised 1-1-89	
Santa Fe, New Mexico 87504-2088 S. Indicate Type of Lasse State City Canal Can	DISTRICT I	OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088		WELL API NO.	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FOOM FOR PROPAGALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DEFFERENT RESERVOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROCOCALS.) 1. Type of Well: WELL				5. Indicate Type of Lease STATE FEE X	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOUR. USE "APPLICATION FOR PERMIT" I. Type of Well: CREATER ASSESSED OF THE SECTION SUCH PROPOSALS) I. Type of Well: CREATER ASSESSED OF THE SECTION SUCH PROPOSALS. II. Type of Well: CREATER ASSESSED OF THE SECTION SUCH PROPOSALS. III. Type of Well: CREATER ASSESSED OF THE SECTION SUCH PROPOSALS. III. Type of Well: CREATER ASSESSED OF THE SECTION SUCH PROPOSALS. III. Type of Well: CREATER ASSESSED OF THE SECTION SUCH STATE SECTION SUCH SECTION	DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410				
Type of Well: CAS	(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"				
2. Name of Operator Shell Western E&P Inc. 3. Address of Operator P.O. BOX 576 Houston, TX 77001–0576 4. Well Loratice Unit Letter N: 330 Feet From The SOUTH Line and 2310 Feet From The WEST Line Section 18 Township 18S Range 38E NMFM LEA County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON GRAPH REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON GHANGE PLANS GASING TEST AND CEMENT JOB OTHER: OTHER: OTHER: OTHER: OTHER: OTHER: OTHER: OTHER: DESCRIPTION OF 4 IN. LINE). SET CICR 9393'. DRLD ON CIBP. PUSHED CIBP REMMANTS TO 4148' (TOP OF 4 IN. LINE). SET CICR 9393'. DRLD ON CIBP. PUSHED CIBP REMMANTS TO 4148' (TOP OF 4 IN. LINE). SET CICR 9393'. SOZD G/SA PERFS 397' 4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DD CICR & CMT TO 4120'. PT SOZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074–91' (2 SPF). ACD PERFS 4074–91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD. I Demoty certify that the information above is true and compilate to the best of my incovindage and ballet. TITLE REGULATORY SUPV. DATE 5/13/91 TITLE REGULATORY SUPV. DATE 5/13/91	Type of Well:				
Shell Western E&P Inc. 3. Address of Operator P.O. Box 576 Houston, TX 77001–0576 WCK 4.4.5.5) P.O. Box 576 Houston, TX 77001–0576 Well Location Unit Letter N: 330 Feet From The SOUTH Line sand 2310 Feet From The WEST Line Section 18 Township 18.5 Range 38. NMPM LEA Country 10. Elevation (Show whether DF, RKB, RT, GR, stc.) 3670' DF 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS CASING TEST AND CEMENT JOB OTHER: OTHER: OTHER: OTHER CASING OTHER: CMT SOZ, OAP & ACD; RTP (PREV TA'D) 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent datas, including estimated data of starting any proposed word) STE RULE 1103. 12–14 TO 12–26–90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LINE). SET CICR @ 3939'. SOZD G/SA PERFS 3979' - 4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SOZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD.		OTHER		P Wall No.	
3. Address of Operacor P.O. Box 576 Houston, TX 77001-0576 W.C.K. 4.4.5.5) 9. Pod name or Wildcat HOBBS (G/SA) 4. Well Lossion Unit Letter N : 330 Feet From The SOUTH Line and 2310 Feet From The WEST Line Section 18 Township 18S Range 38E NMPM LEA County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3870' DF 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING OTHER: OTHER: CMT SOZ, OAP & ACD; RTP (PREV TA'D) 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed worth) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300\$, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LNR). SET CICR @ 3939'. SOZD G/SA PERFS 3979' — 4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SOZ TO 300\$, HELD OK 30 MIN. RAN GR/CCL FROM \$500' TO 4120'. PERF SA 4074-91' (Z SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD.	•				
P.O. Box 576 Houston, TX 77001-0576 Well Lossion Unit Letter N : 330 Feet Proon The SOUTH Line and 2310 Feet From The WEST Line Section 18 Township 18S Range 38E NMPM LEA County 10. Elevation (Shore whether DF, RKB, RT, GR, etc.) 3670' DF 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING CHANGE PLANS CASING TEST AND CEMENT JOB OTHER: OTHER: OTHER: OTHER: TOWNSHIP SEE RULE 1103. 12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent datas, including estimated date of starting any proposed worth) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LNR). SET CICR @ 3939'. SOZD G/SA PERFS 3979' - 4273' W/150 SX CLS C CMT + 2% CACL 2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SOZD TO 300#, HELD OX 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERFS 34 074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD.		(hick 11.35)		
Well Location Unit Letter N : 330 Feet From The SOUTH Line and 2310 Feet From The WEST Line Section 18 Township 18S Range 38E NMPM LEA Country 10. Elevation (Show whather DF, RKB, RT, GR, stc.) 3670' DF 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: OTHER: OTHER: CMT SOZ, OAP & ACD; RTP (PREV TA'D) 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMAINS TO 4148' (TOP 0F 4 IN. LNR). SET CICR @ 3939'. SOZD G/SA PERFS 3979' - 4279' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD. I Leneby cardify that the information above is true and complete to the best of my troowledge and belief. TILE REGULATORY SUPV. DATE 5/13/91 TILE REGULATORY SUPV. DATE 5/13/91	•	(77001-0576		HOBBS (G/SA)	
Section 18 Township 18S Range 38E NMFM LEA County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3670' DF 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDON CHANGE PLANS CASING TEST AND CEMENT JOB OTHER: OTHER: CMT SQZ, OAP & ACD; RTP (PREV TA'D) 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP © 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN, LNR). SET CICR © 3939'. SQZD G/SA PERFS 3979' - 4273' W/150 SX CLS C CMT + 2½ CACL 2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD.					
10. Elevasions (Show whether DF, RKB, RT, GR, etc.) 3670' DF 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON COMMENCE DRILLING OPNS. ALTERING CASING COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT CASING TEMPORARILY ABANDON CHANGE PLANS CASING TEST AND CEMENT JOB OTHER: OTHER: CMT SQZ, OAP & ACD; RTP (PREV TA'D) 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LNR). SET CICR @ 3939'. SQZD G/SA PERFS 3979' - 4273' W150 SX CLS C CMT + 2½' CACL2. WOC OVERNITE. DO COR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD.	Unit Letter N: 3	30 Feet From The SOUTH	Line and	2310 Feet From The WEST Line	
TILE REGULATORY SUPV. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: CMT SQZ, OAP & ACD; RTP (PREV TA'D) 12 Describe Proposed or Completed Operations (Clearly state all persinent details, and give persinent dates, including assimated date of starting any proposed work) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LNR). SET CICR @ 3939'. SQZD G/SA PERFS 3979' - 4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD.	Section 18			NMPM LEA County	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK		/////X	DF, RKB, KT, GR, etc.)		
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK	11. Check	Appropriate Box to Indicate N	Nature of Notice, F	Report, or Other Data	
COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT CASING CASING TEST AND CEMENT JOB OTHER: OTHER: OTHER: CMT SQZ, OAP & ACD; RTP (PREV TA'D) 12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LNR). SET CICR @ 3939'. SQZD G/SA PERFS 3979' - 4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD. I hereby certify that the information above is true and complete to the best of my knowledge and belief. BIONATURE TITLE REGULATORY SUPV. DATE 5/13/91		• • •		• · · · · · · · · · · · · · · · · · · ·	
CASING TEST AND CEMENT JOB OTHER: OTHER: CMT SQZ, OAP & ACD; RTP (PREV TA'D) 12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LNR). SET CICR @ 3939'. SQZD G/SA PERFS 3979' - 4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD. I hereby certify that the information above is true and complete to the best of my knowledge and bolid. BIONATURE H. TITLE REGULATORY SUPV. DATE 5/13/91	PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING	
OTHER:	TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLIN	IG OPNS. PLUG AND ABANDONMENT	
12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LNR). SET CICR @ 3939'. SQZD G/SA PERFS 3979' - 4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD. Thereby certify that the information above is true and complete to the best of my knowledge and belief. SKONATURE TITLE REGULATORY SUPV. DATE 5/13/91	PULL OR ALTER CASING		CASING TEST AND C	CEMENT JOB []	
North) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO CMT CAP ON CIBP @ 3949' TO 3968'. DRLD ON CIBP. PUSHED CIBP REMNANTS TO 4148' (TOP OF 4 IN. LNR). SET CICR @ 3939'. SQZD G/SA PERFS 3979' - 4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD. I hereby certify that the information above is true and complete to the best of my knowledge and belief. SKONATURE TITLE REGULATORY SUPV. DATE 5/13/91	OTHER:		OTHER: CMT SQZ,	OAP & ACD; RTP (PREV TA'D)	
4273' W/150 SX CLS C CMT + 2% CACL2. WOC OVERNITE. DO CICR & CMT TO 4120'. PT SQZ TO 300#, HELD OK 30 MIN. RAN GR/CCL FROM 3500' TO 4120'. PERF SA 4074-91' (2 SPF). ACD PERFS 4074-91' W/3500 GALS 15% NEFE HCL. INST PROD EQUIP & RETD WELL TO PROD. I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE TITLE REGULATORY SUPV. DATE 5/13/91	work) SEE RULE 1103. 12-14 TO 12-26-90: PT CSG TO 300#, HELD. DO	CMT CAP ON CIBP @ 3949' TO 3	3968'. DRLD ON C	IBP. PUSHED	
SIGNATURE TITLE REGULATORY SUPV. DATE 5/13/91	4273' W/150 SX CLS C CMT SQZ TO 300#, HELD OK 30 MI	+ 2% CACL2. WOC OVERNITE. N. RAN GR/CCL FROM 3500' 1	DO CICR & CMT TO TO 4120'. PERF S	O 4120'. PT A 4074-91' (2 SPF).	
SIGNATURE TITLE REGULATORY SUPV. DATE 5/13/91					
SIGNATURE TITLE REGULATORY SUPV. DATE 5/13/91					
SIGNATURE TITLE REGULATORY SUPV. DATE 5/13/91			4.		
SIGNATURE THE TOTAL TOTA	I hereby certify that the information above is to	ue and complete to the best of my knowledge and			
TYPE OR PRINT NAME J. H. SMITHERMAN TELEPHONE NO. 713/870-	SIGNATURE ATTIMULE	ieman m	REGULATORY S	DAID	
	TYPE OR PRINT NAME J. H. SMITH	ERMAN		TELEPHONE NO. 713/870-3	
(This space for State Use)	(This space for State Line)				

– mle -

CONDITIONS OF APPROVAL, IF ANY:

APTROVED BY -