

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form O-103
Revised 10-1-79

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT (FORM O-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐ 1. Name of Operator SHELL WESTERN E&P INC. 2. Address of Operator P. O. BOX 576, HOUSTON, TEXAS 77001 (WCK 4435) 3. Location of Well UNIT LETTER <u>P</u> <u>330</u> FEET FROM THE <u>SOUTH</u> LINE AND <u>990</u> FEET FROM THE <u>EAST</u> LINE, SECTION <u>18</u> TOWNSHIP <u>18-S</u> RANGE <u>38-E</u> NEPM. 14. Elevation (Show whether DF, RT, GR, etc.) 3662' DF 12. County LEA	7. Unit Agreement Name N. HOBBS (G/SA) UNIT 8. Form of Lease Name SECTION 18 9. Well No. 441 10. Field and Pool, or Widest HOBBS (G/SA)
--	--

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐ TEMPORARILY ABANDON ☐ PULL OR ALTER CASING ☐ OTHER ☐	PLUG AND ABANDON ☒ CHANGE PLANS ☐ OTHER ☐	REMEDIAL WORK ☐ COMMENCE DRILLING OPER. ☐ CASING TEST AND CEMENT JOB ☐ OTHER ☐	ALTERING CASING ☐ PLUG AND ABANDONMENT ☐
---	---	---	---

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Run CBL/VDL/CCL/GR log from PBTD (3814') to surf under 0 psi & 500 psi.
2. IF TOC is above top of Bowers fm (approx 3260'), spot 9.5#/gal mud from 3814' to 3260'. Spot CIs "C" cmt from 3260' to 3160'. If TOC is below Bowers fm, perf @ 3160' (2 JSPF). Sqz 50 sx CIs "C" cmt into fm & leave 100' cmt plug in csg to 3160'.
3. Spot 9.5#/gal mud from 3160' to 2715'.
4. Spot CIs "C" cmt across bad csg interval 2409' - 2715'.
5. Spot 9.5#/gal mud from 2409' to 250'.
6. Perf csg @ 250' (2 JSPF).
7. Att to circ CIs "C" cmt to surf. If circ can't be established, sqz 50 sx CIs "C" cmt into fm & leave 50 sx in csg. Spot 9.5#/gal mud to surf.
8. Cut off csg below GL, weld on steel plate & install P&A marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed A. J. FORE TITLE SUPERVISOR REG. & PERMITTING DATE AUGUST 14, 1987

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR

AUG 19 1987

APPROVED BY _____ TITLE _____ DATE _____