

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐
Name of Operator
SHELL WESTERN E&P INC.
Address of Operator
P. O. BOX 576, HOUSTON, TEXAS 77001 (WCK 4435)
Location of Well
UNIT LETTER E 2310 FEET FROM THE NORTH LINE AND 333 FEET FROM
THE WEST LINE, SECTION 19 TOWNSHIP 18S RANGE 38E N.M.P.M.

7. Unit Agreement Name
N. HOBBS (G/SA) UNIT
8. Farm or Lease Name
SECTION 19
9. Well No.
121
10. Field and Pool, or Wildcat
HOBBS (G/SA)

15. Elevation (Show whether DF, RT, GR, etc.)
3666' DF

12. County
LEA

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPERATIONS ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER CSG REPAIR, OAP & ACDZ ☒	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. POH w/prod equip. Tag btm.
2. CO to 4-1/2" lnr shoe @ 4250'.
3. Isolate csg lk located btw 3930' & 4106'.
4. Set CIBP at least 40' below csg lk.
5. Set CICR at least 40' above csg lk.
6. Sqz csg lk w/100 sx Cls "C" cmt + 2% CaCl₂ + 1.5% Howco suds + 0.75% HC-2 + 200 SCF N₂/bbl followed by 25 sx Cls "C" cmt + 2% CaCl₂. WOC 24 hrs.
7. DO CICR & cmt to 10' above CIBP. Pres tst sqz to 500#.
8. DO cmt & CIBP. CO to TD @ 4280'.
9. Perf San Andres 4191' - 4221' (2 JSPF).
10. CO to lnr shoe @ 4250'.
11. Acdz perms 4191' - 4221' & OH 4250'-80' w/3000 gals 15% HCl-NEA + 1500# rock salt.
12. Install prod equip & return well to prod.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

W. F. N. Kelldorf TITLE STAFF PRODUCTION ENGINEER

DATE 4-13-88

APPROVED BY TITLE DATE