

Rigged up to Plug and Abandon 8-1-75. Set Titan CIBP @ 3095'. Dumped 7 sacks cement on top of BP. PBTD 3060'. Ran 2-3/8" tubing to 3000'. Circulated hole with 123 bbls. brine water w/23 sacks salt gel. Pulled tubing. Tried pumping into 9-5/8" casing. Pumped 2-1/2 bbls. Pressured up to 500#, held. Shot casing in collar at 2547'. Pulled and layed down 84 joints (2555') 7" casing. Ran tubing to 2616' and layed 28 sack cement plug from 2616' to 2516'. Pulled up to 1575', layed 37 sack cement plug from 1575 to 1475'. Layed down tubing and put 10 sack plug in top.

Installed dry hole marker 8-26-75. Location cleaned up and ready for inspection.

	hat the information above is the state of the state		. ·	•
C.L.	Original Listed By Wade: C. L. Way	AREA SUPERINTENDENT	8~27~ 7 5	2
	OT D			
no. Secondo da 🖌	John W. Tunyan			