

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name N. HOBBS (G/SA) UNIT SECTION 30
8. Well No. 411
9. Pool name or Wildcat HOBBS (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER	
2. Name of Operator SHELL WESTERN E&P INC.	
3. Address of Operator P. O. BOX 576, HOUSTON, TX 77001 (WCK 4435)	
4. Well Location Unit Letter <u>A</u> : <u>330</u> Feet From The <u>NORTH</u> Line and <u>330</u> Feet From The <u>EAST</u> Line Section <u>30</u> Township <u>18S</u> Range <u>38E</u> NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3659' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
PLUG AND ABANDON ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	COMMENCE DRILLING OPNS. ☐
CHANGE PLANS ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	CASING TEST AND CEMENT JOB ☐
OTHER: <u>Cmt sqz, OAP & acdz</u> ☒	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. POH w/prod equip.
2. CO to CIBP @ 4150'.
3. Set CIBP @ 4016'.
4. Sqz GB perf 4056' - 4124' w/150 sx Cls "C" cmt + 2% CaCl₂ + 1.5% HOWCO suds + 0.75% HC-2 + 200 SCF N₂/bbl followed by 50 sx Cls "C" cmt + 2% CaCl₂. Cap CIBP w/5' cmt, WOC 24 hrs.
5. DO cmt to CIBP @ 4150'.
6. Pres tst sqz to 500#.
7. DO CIBP & push to 4296' (PBTD). CO to 4296'.
8. Perf SA 4152'-56' (2 JSPF).
9. Set RBP @ 4296'. Acdz perfs 4240'-87' w/500 gals 15% NEFE HCl.
10. Rel RBP & reset @ 4166'. Acdz perfs 4152'-56' w/500 gals 15% NEFE HCl.
11. Rel RBP & POH.
12. Install prod equip & ret to prod.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. H. Smitherman TITLE REGULATORY SUPV. DATE 2-2-90

TYPE OR PRINT NAME J. H. SMITHERMAN (713) 870-3797 TELEPHONE NO.

(This space for State Use)

ORIGINAL SIGNED BY JERRY CANTON

APPROVED BY DISTRICT I SUPERVISOR TITLE DATE

CONDITIONS OF APPROVAL, IF ANY:

REC-8453

FEB 1 1930

CC
NOBRS 1930