

Form 100-104
(November 1983,
(Formerly 9-331)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN FR. DATE:
(Other instructions on re-
verse side)

Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. NAME OF OPERATOR
SHELL WESTERN E&P INC.
3. ADDRESS OF OPERATOR
P. O. BOX 576, HOUSTON, TEXAS 77001 (WCK 4435)
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface UNIT LTR J, 2335' FSL & 2310' FEL
14. XXXXXXXX API NO.
30-025-07472
15. ELEVATIONS (Show whether DF, RT, GR, etc.)
3654' DF

5. LEASE DESIGNATION AND SERIAL NO.
LC 032233 (a)
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
N. HOBBS (G/SA) UNIT
8. FARM OR LEASE NAME
SECTION 30
9. WELL NO.
331
10. FIELD AND POOL, OR WILDCAT
HOBBS (G/SA)
11. SEC., T., R., M. OR BLK. AND
SURVEY OR AREA
SEC. 30, T18S-R38E
12. COUNTY OR PARISH
LEA
13. STATE
NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)

PULL OR ALTER CASING
MULTIPLE COMPLETION
ABANDON
CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)

REPAIRING WELL
ALTERING CASING
ABANDONMENT

RAN CROSSFLOW CHECK & ZONE TEST

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- 9-27-86: Pulled production equipment. Ran GR base & temp run. Made crossflow checks @ 4000' - 4210'.
- 9-29-86: CO to PBTD (tagged @ 4192'). Set RBP @ 4060' & pkr @ 4052'. Pres tstd csg to 1000#, leaked. Reset pkr @ 4054', pres to 1000#, leaked. Pulled pkr to 3995', pres to 500#, held OK. Reset pkr @ 4056', pres to 1000#, leaked. Reset RBP @ 3995' & pkr @ 3990'. Pres tstd RBP to 1000#, held OK. Reset RBP @ 4054' & pkr @ 4050', pres tstd to 1000#, leaked 400# in 4 min. POH w/pkr.
- 9-30-86: Installed production equipment and returned well to production.

18. I hereby certify that the foregoing is true and correct

SIGNED L. C. Carter A. J. FORE

TITLE SUPERVISOR REG. & PERMITS

DATE NOVEMBER 20, 1986

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

12 2 86

*See Instructions on Reverse Side