

Rigged up 7-30-75, pulled rods and pump. Set Titan cast-iron bridge plug at 3100'. Dumped 5 sacks cement on top of BP. PBTD @ 3062'. Circualted hole w/brine mud. (75 bbls. of 9.2# brine w/17 sacks of salt gel.) Layed 20 sack cement plug from 1542' back to 1374'. Laid 10 sack cement plug in top.

Installed dry hole marker 8-26-75 and cleaned up location. Ready for inspection.

		the information above a state of the of			
C.L.	Wade:	BIGINAL SIGNED BY: C. L. N.de	AREA SUPERINTENDENT	8-27-75	
<u>a</u> larin (1918)	$\mathcal{Q}_{\mathbf{r}}$	Runna		-4 4	
akeru. Constants		DVAL, IF AND			