

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-20020
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 874850
7. Lease Name or Unit Agreement Name WARN STATE A/C 2
8. Well No. 10
9. Pool name or Wildcat VACUUM (ABO REEF)
10. Elevation (Show whether DP, RKB, RT, GR, etc.) GL: 3978' KB: 3990'

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator Marathon Oil Company
3. Address of Operator P.O. Box 552 Midland, Tx. 79702	4. Well Location Unit Letter <u>K</u> : <u>1650</u> Feet From The <u>SOUTH</u> Line and <u>2233</u> Feet From The <u>WEST</u> Line Section <u>6</u> Township <u>18-S</u> Range <u>35-E</u> NMPM LEA County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MARATHON OIL COMPANY RECENTLY PLUGGED AND ABANDONED THE WARN STATE A/C 2 WELL NO. 10 FOLLOWING AN UNSUCCESSFUL ATTEMPTED RECOMPLETION TO THE DRINKARD. PLEASE FIND ENCLOSED A WELL HISTORY OF THIS WORK.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Brent D. Lockhart TITLE ADVANCED ENG. TECH. DATE 12/28/92
TYPE OR PRINT NAME BRENT D. LOCKHART TELEPHONE NO. 915-682-1626

(This space for State Use)

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE JAN 21 1993
CONDITIONS OF APPROVAL, IF ANY:

WARN STATE A/C/ 2 WELL NO. 10
PLUG & ABANDON

11/18/92 MIRU PU to attempt recompletion to Drinkard.

11/19/92 Attempted to unseat pump. Rods parted. ND wellhead. NU BOP's. PU on
tbg. Tbg unscrewed 4 jts down. RIH w/overshot & grapple on 2-7/8" tbg.

11/20/92 - Fished & milled over rods & tbg.
12/18/92 Retrieved tbg & rods to 5050'. Decided to P&A well.

12/19/92 POOH w/2-7/8" tbg. RIH w/5-1/2" CIBP on 2-7/8" tbg. Set CIBP @ 5056'.
 POOH w/2-7/8" tbg. RIH w/muleshoe on 2-7/8" tbg to 5000'.

12/20/92 Circulated hole w/salt gel. Pumped 60 sx cmt plug w/TOC @ 4486'. Displaced
w/fresh water. PUH to 3357'. Pumped 25 sx cmt w/CaCl plug. Displaced
w/fresh water. TOC @ 3113'. PUH to 1519'. Pumped 20 sx cmt plug w/TOC
@ 1329'. Displaced w/fresh water. PUH to 424'. Pumped 20 sx cmt plug
w/TOC @ 234'. POOH w/2-7/8" tbg. ND BOP's. Pumped 6 sx cmt plug to
surface. Dug bell hole around wellhead. SDFN.

12/21/92 Cut off wellhead. Installed P&A marker. RDPU. Cleaned location. MOL.