

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-20213
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-1258-1
7. Lease Name or Unit Agreement Name NEW MEXICO "AE" STATE
8. Well No. 18
9. Pool name or Wildcat VACUUM ABO REEF

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator Texaco Exploration and Production Inc.	
3. Address of Operator P. O. Box 730 Hobbs, NM 88240	
4. Well Location Unit Letter <u>F</u> : <u>1980</u> Feet From The <u>NORTH</u> Line and <u>1980</u> Feet From The <u>WEST</u> Line Section <u>11</u> Township <u>18-S</u> Range <u>34-E</u> NMPM LEA	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4004' DF	

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

9/30/92 - 10/7/92

- MIRU. TOH W/ PROD EQUIP. SET CIBP @ 8660' & CAPPED W/ 35' CLASS C CMT. STARTING DATE 9/30/92.
- RAN FREEPOINT ON 2 7/8" CSG, FREE @ 750', CIRC HOLE W/ SALT GEL MUD.
- SET CIBP @ 6100' & CAPPED W/ 35' CLASS C CMT.
- SET CIBP @ 5030' & CAPPED W/ 35' CLASS C CMT.
- SET CIBP @ 3277' & CAPPED W/ 35' CLASS C CMT.
- SET CIBP @ 3000' & CAPPED W/ 35' CLASS C CMT.
- SET CIBP @ 1740' & CAPPED W/ 35' CLASS C CMT.
- CUT & PLD CSG @ 743', CIRC HOLE W/ SALT GEL MUD.
- SPTD 30 SX PLUG CLASS C CMT @ 743', TOH TO 381' & SPTD ANOTHER 30 SX PLUG CLASS C CMT. SPTD 10 SX PLUG @ SURF.
- CUT WELLHEAD, INSTALLED DRY HOLE MARKER, CLEANED LOCATION. COMPLETION DATE 10/7/92.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Monte C. Duncan TITLE ENGINEER'S ASSISTANT DATE 10/27/92

TYPE OR PRINT NAME MONTE C. DUNCAN TELEPHONE NO. 393-7191

(This space for State Use)

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE JAN 26 1993

CONDITIONS OF APPROVAL, IF ANY: