

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-20265
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	B-1258-1

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name New Mexico "AE" State
2. Name of Operator Texaco Exploration and Production Inc.	8. Well No. 20
3. Address of Operator P.O. Box 730 Hobbs, New Mexico 88240	9. Pool name or Wildcat Vacuum Abo Reef
4. Well Location Unit Letter <u>M</u> : <u>920</u> Feet From The <u>South</u> Line and <u>916</u> Feet From The <u>West</u> Line Section <u>12</u> Township <u>18-S</u> Range <u>34-E</u> NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3996' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

03/03/92 - 03/16/92

1. MIRU w/P&A equipment. Starting date 3-03-92.
2. Fished stuck rods, left 18 3/4" rods & rod pmp in hole.
3. Set CIBP @ 8315', capped w/ 35' Class C cmt.
4. Loaded hole w/ salt gel mud. Set CIBP @ 5183', capped w/ 35' Class C cmt. Ran freepoint on 2 7/8" csg, csg free @ 3300'.
5. Set CIBP @ 3594', capped w/ 35' Class C cmt. Cut csg @ 3274' & pld csg.
6. Loaded hole w/ salt gel mud. Spt 100' plug (33 sxs Class C cmt) @ 3274'.
7. Pld to 1883', spt 100' plug (30 sxs Class C cmt). Pld up, spt 15 sx surf plug.
9. Cut off wellhead, installed dry hole marker, cleaned location. Completion date 3-16-92.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE M.C. Duncan TITLE Engineer's Assistant DATE 3-26-92
TYPE OR PRINT NAME M.C. Duncan TELEPHONE NO. 393-7191

(This space for State Use)

APPROVED BY [Signature] TITLE DISTRICT SUPERVISOR DATE SEP 11 1992
CONDITIONS OF APPROVAL, IF ANY: