

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	3002521106
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	B-3936-1
7. Lease Name or Unit Agreement Name	New Mexico "AA" State NCT-4
8. Well No.	SWD #1
9. Pool name or Wildcat	Vacuum (SWD Well)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER ☒ (SWD)	2. Name of Operator Texaco Producing Inc.
3. Address of Operator P.O. Box 730, Hobbs, NM 88240	4. Well Location Unit Letter B : 500 Feet From The North Line and 1830 Feet From The East Line Section 10 Township 18S Range 34E NMPM Lea County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4030' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

SEE ATTACHMENT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Richard DeSoto TITLE Engineering Technician DATE 06/29/90
TYPE OR PRINT NAME R. B. DeSoto TELEPHONE NO. 393-7191

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
OIL CONSERVATION DIVISION
STATE OF NEW MEXICO
TO BE APPROVED

RECOMMENDATION FOR ABANDONMENT
NEW MEXICO "AA" STATE NCT-4 SWD NO. 1
VACUUM FIELD
LEA COUNTY, NEW MEXICO

ABANDONMENT PROCEDURE

1. MIRU pulling unit. Install BOP.
2. Run cement bond log to locate TOC.
3. TIH with tubing to PBTD (4990'). Load hole with 10# brine containing 25 lb. gel per barrel.
4. Spot 25 sx. (215') cement plug on top of CIBP from 4775-4990 (Class H cement, 15.6 ppg, 1.18 cu. ft./sx., 5.19 gal/sx.). Tag plug.
5. Pull up hole. Spot 25 sx. (215') cement plug at base of salt from 2940-3155. Tag plug.
6. Pull up hole. Spot 25 sx. (215') cement plug at top of salt from 1675-1890. Tag plug. TOH with tubing.
7. Perforate 2 squeeze holes 100' above TOC. TIH with packer and tubing. Establish circulation through squeeze holes to surface. TOH with tubing and packer. Set cement retainer above squeeze holes with wireline.
8. TIH with tubing, and sting into c.r. Circulate cement to surface. Spot 25 sx. (215') cement plug on top of c.r.
9. Pull up hole. Spot 25 sx (215') cement plug from 275-490 across 8 5/8" casing shoe. Tag plug.
10. Pull up hole. Spot 10 sx. (86') cement plug from 86' to surface.
11. Cut off wellhead. Install marker. Clean location.

Well N.M. "AA" State NCT-4 SWD
 Date 6-1-90
 Elevation 4030' KB (10' AGL)

