

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease  
State ☒ Fee ☐  
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator <b>Cities Service Oil Company</b>	8. Farm or Lease Name <b>State CD</b>
3. Address of Operator <b>Box 69, Hobbs, New Mexico 88240</b>	9. Well No. <b>2</b>
4. Location of Well UNIT LETTER <b>L</b> <b>2310</b> FEET FROM THE <b>South</b> LINE AND <b>990</b> FEET FROM THE <b>West</b> LINE, SECTION <b>32</b> TOWNSHIP <b>17S</b> RANGE <b>33E</b> NMPM.	10. Field and Pool, or Wildcat <b>Maljamar (G-SA)</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>4023' DF</b>	12. County <b>Lea</b>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The above well was plugged and abandoned in the following manner:

1. Loaded hole w/mud laden fluid.
2. Set 25 sack cement plug @ PBD (4468') to cover perfs. @ 4337, 4399 and 4342.
3. Set 35 sack cement plug @ 1050' cut point of 4½" casing, half of plug in and half out of casing stub.
4. Displaced 25 sack plug at base of 8 5/8" from 368' to 290'.
5. Set 10 sack plug from surface to 30' w/4" dry hole marker extending 4' above ground level.
6. Cleaned location of all debris and equipment, filled pits and cellar.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED John W. Runyon TITLE District Clerk DATE 12-8-67  
APPROVED BY John W. Runyon TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY: