

17. POH w/tbg. Remove DC's. GIH w/bit & tbg. Drld on CIBP @ 11,139'. Drld on CIBP for 5 hrs. POH. Cone missing on bit. Ran mill to 1240'. Pulling unit broke dwn.
18. GIH w/tbg. Repaired PU. POH w/tbg. GIH w/mill. Work thru tight place @ 11,100'. Finished drlg out CIBP. Ran mill to 11,260'. Circ hole clean. Pull mill to 8740'. RU Swb unit. POH w/tbg. Mill was missing. GIH w/tbg & pkr. Check for mill in tight place @ 11,100'. Was not there. Fell to PBD 12,165'. Set pkr @ 10,860'. Btm tbg @ 10,891'. Swbd 6 BLW. RDPU.
19. RU swb unit. Swbd 50 BLW in 10 hrs. FL @ 10,000'. SI.
20. Swbd 1 BO & 34 BW w/small amt gas. FL 10,400'. SI.
21. GIH w/tbg. MIRUPU. POH w/tbg & pkr. GIH w/rods. Ran 2 3/8" & 2 7/8" tbg. Set @ 11,072'. SN @ 11,037'. Anchor catcher @ 10,918'. GIH w/BHP & rods to 5400'. RDPU. Ran rods & BHP.
22. MIPU. Hooking up wellhead. MI & set pump. Hooked up WH & test separator to tst tank. Started well pmpg. Unit dwn, belts off. Installed belts & realign motor w/pumping unit.
23. Pumping. Pmpd 1 BLW w/tr oil in 21 hrs. Shot Fluid level 10,771'. SI.
24. Workover unsuccessful. Now SI.

\*\*\*

10-22-82  
C. Nokes