

UNITED STATES
DEPARTMENT OF THE INTERIORSUBMIT IN TRIPLICATE
(Other Instructions on
reverse side)Form approved.
Budget Bureau No. 42-R1421

GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. UNIT AGREEMENT NAME	
2. NAME OF OPERATOR <i>Humble Oil & Refg Co</i>		8. FARM OR LEASE NAME <i>Bowers A. Fadden</i>	
3. ADDRESS OF OPERATOR <i>Box 1100 - Midland, Texas 79701</i>		9. WELL NO. <i>28</i>	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface <i>660' FSL, 990' FWL</i>		10. FIELD AND POOL, OR WILDCAT <i>Hobbs Blinberry</i>	
14. PERMIT NO. <i>-</i>		15. ELEVATIONS (Show whether DF, RT, OR, etc.) <i>3650 DF</i>	
		11. SEC., T., R., M., OR S.W. 1/4 AND SURVEY OR AREA <i>S29, T18S, R38E</i>	
		12. COUNTY OR PARISH <i>Lea</i>	
		13. STATE <i>N. Mex</i>	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETION ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANS ☐
(Other) ☐	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐	REPAIRING WELL ☒
FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☒	ABANDONMENT* ☐
(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

MIRU. pulled equip. out of hole. Set Retrievable bridge plug @ 5600'. Perf 5 1/2" csq w/ 1 RASF jet shot per ft. from 5433 to 5435, 5439-5442, 5449-5452. Acidized w/ 500 gal. NE acid, max 1000 psi, min 250 psi, Rate 146 BPM. Swabbed well & recovered acid water and small amt of oil. Squeezed above perfs w/ 55 sax amt @ 3000 psi @ 3 BPM and reverse out 45 sax. Perf 5 1/2" csq w/ 1 RASF jet shot / ft. from 5376-5381, 5384-5386, 5392-5398 and 5400'. Acidized perfs w/ 500 gal NE acid @ 1000 psi. Swabbed well and recovered all water. Reacidized w/ 1500 gal. NE acid, max. 2600 psi @ 2.5 BPM. Swabbed well and recovered water. Squeezed above perfs w/ 75 sax amt @ 1700 psi and reverse out 15 sax. RU and drilled out retainers and fish bridge plug. Reran production equipment to bottom and return well to producing status.

18. I hereby certify that the foregoing is true and correct

SIGNED *A. E. Clemmer*TITLE *Unit Head*DATE *5/8/69*

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:TITLE *J. L.*

DATE _____