

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instruction 1 re-
verse side)

Form approved.
Budget Bureau No. 42-211-1

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐ <i>Drilg</i>		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR <i>Humble Oil & Refg Co</i>		8. FARM OR LEASE NAME <i>Bowers A Federal Con</i>
3. ADDRESS OF OPERATOR <i>Box 1600 - Midland Texas</i>		9. WELL NO. <i>33</i>
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface <i>800 FNL, 660' FNL</i>		10. FIELD AND POOL OR WILDCAT <i>Hobbs C-5A and Hobbs C-10A</i>
14. PERMIT NO. <i>—</i>	15. ELEVATIONS (Show whether DF, RT, GR, etc.) <i>—</i>	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA <i>S29-T18S-R2SE</i>
		12. COUNTY OR PARISH <i>Lea</i>
		13. STATE <i>N. Mex</i>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANS ☐
(Other) ☐	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☒
(Other) <i>Completion Attempts</i>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Cont #3 Set C.I. BP @ 5800' and Cap w/ 1 5/8" cmt on top. Mex perf 7" CSG from 4261-4270' w/ 10 shots. Test and recover 90 bbl water. Squeeze off perfs w/ 150 50% cmt. Perf from 4256-4266' and acidize w/ 500 gal NE acid. Reacidize w/ 3000 gal - 15% NE acid @ 500 psi @ 3.6 BPM. Test and recover 100% water. Pull tbq - rods & pump. Squeeze off perfs. Perf 7" CSG from 4144-4145' w/ 5 shots. Treat perfs w/ 500 gal - 15% MCA acid. Test and recover water w/ small amt oil & gas. Set Baker plug @ 3978' and dump 8' cmt on top. Pull rods pump and tbq. Well T.A. 1-3-70

18. I hereby certify that the foregoing is true and correct

SIGNED

[Signature]

TITLE

Unit Head

DATE

3/7/70

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: