

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 3002503094	
5. Indicate Type of Lease STATE ☒ FEE ☐	
6. State Oil & Gas Lease No. 011122	
7. Lease Name or Unit Agreement Name Central Vacuum Unit	
8. Well No. 131	
9. Pool name or Wildcat Vacuum Grayburg, San Andres	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER injection	
2. Name of Operator Texaco E&P Inc.	
3. Address of Operator P.O. Box 3109 Midland, TX 79702	
4. Well Location Unit Letter <u>E</u> : <u>2119</u> Feet From The <u>North</u> Line and <u>918</u> Feet From The <u>West</u> Line Section <u>7</u> Township <u>18S</u> Range <u>35-E</u> NMPM Lea County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3973' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
1. Notify NMOCD of intent to plug & abandon well prior to plugging.
 2. Est. injection rate down 2-3/8" tub. w/PKR set @ 4337', pump 150 sks cmt. into perf. at 4426-4712. (San Andres) displace cmt. just below PKR @ 4337'. WOC & tag. (Circ. csg. w/25# per BBL. salt gel & 10# brine)
 3. POOH to 4000'. Spot 25 sks cmt. 4000-3900 (Queens)
 4. POOH to 3000'. Spot 25 sks cmt. 3000-2900 (Yates)
 5. RUWL & jet cut 4 1/2" csg. @ 1750' & laydown same.
 6. TIH w/tub to 1750' & spot 65 sks cmt plug 1750-1600 (top salt & 8-5/8" csg. shoe) WOC & tag.
 7. POOH to 50'. Spot 25 sks cmt. plug f/50' to surface.
 8. Cut off wellhead & weld on cap & install dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE RJ Harding III TITLE Operations Engineer DATE 11-14-94

TYPE OR PRINT NAME RJ Harding III TELEPHONE NO. (915) 688-4816

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: