

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
E-1356-5	

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Koch Exploration Company	8. Farm or Lease Name Vacuum State
3. Address of Operator P. O. Box 2256 Wichita, Kansas 67201	9. Well No. #1
4. Location of Well UNIT LETTER <u>L</u> <u>2086</u> FEET FROM THE <u>South</u> LINE AND <u>766</u> FEET FROM THE <u>West</u> LINE, SECTION <u>4</u> TOWNSHIP <u>17S</u> RANGE <u>34E</u> NMPM.	10. Field and Pool, or Wildcat Vacuum/Grayburg-SA
15. Elevation (Show whether DF, RT, GR, etc.) 4095.6' GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugging Company: Casing Services & Salvage Hobbs, New Mexico 88240

### Plugging Procedure:

- 1) Ran & set 4-1/2" CIBP @ 4600'
- 2) Spot 35 sx cmt plug on top of CIBP
- 3) Cut 8-5/8" intermediate csg @ 1264' (free pt)
- 4) Pull & LD 32 jts 8-5/8" csg (1264')
- 5) Ran tbq & spot 35 sx plug @ 1470'
- 6) Pull tbq up to 1295' & spot 40 sx cmt plug
- 7) Displace hole w/mud
- 8) Pull up & spot 85 sx cmt plug @ 390', in & out of base of 13-3/8" surface csg
- 9) 10 sx plug @ surface w/regulation dry hole marker
- 10) Plugging completed July 24, 1976.

RECEIVED

1983

1983

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Vernon J. Lowe TITLE Operations Manager DATE July 26, 1983

APPROVED BY Daniel C. Laramie TITLE OIL & GAS INSPECTOR DATE OCT 19 1983

CONDITIONS OF APPROVAL, IF ANY: