STATE OF NEW MEXICO ENERGY AND MINERALS DEPARTMENT

1101 210 111121 120 21		
	I	
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

OIL CONSERVATION DIVISION

we, or torico acceives	JIE CONSERVATION DIVISION	Form C-103
DISTRIBUTION	P. O. BOX 2088	Revised 10-1-73
SANTA FE	SANTA FE, NEW MEXICO 87501	
FILE		5a. Indicate Type of Lease
U.S.O.S.		State X Fee
LAND OFFICE		5. State Oil & Gas Lease No.
		l l
OPERATOR	LJ	В-1113-1
SUI	NDRY NOTICES AND REPORTS ON WELLS	
(DO MET USE YHIS FORM FO	R PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVANT.	
		7. Unit Agreement Name
1. 01 648 7		Central Vacuum Unit
were the were	OTHER.	8. Farm or Lease Name
2. Name of Operator		Central Vacuum Unit
TEXACO Inc.		
		9. Well No.
3. Address of Operator	27 27 27 27 27 20 00010	111
P. O. Box 728, Ho	bbs, New Mexico 88240	In-Field and Pool or Wildcat
4. Location of wall		10VECULING GREYBUY B'cat
ĸ	2310 FEET FROM THE South LINE AND 1750 FEET FROM	San Andres
UNIT LETTER	2310 FEET FROM THE SOULCH LINE AND 1700 FEET FAC	
	/ 10 c 25_F	
West	SECTION 6 TOWNSHIP 18-S RANGE 35-E NMP	~ ΛΙΙΙΙΙΙΙΙΙΙΙΙΙΙΙΙΙΙΙΙΙΙ
THE LINE, !	SECTION	
mmmmm	15. Elevation (Show whether DF, RT, GR, etc.)	12. County
	3989' (DF)	Lea
	/////// 3909, (nr)	
15. Che	eck Appropriate Box To Indicate Nature of Notice, Report or C	Other Data
		NT REPORT OF:
NOTICE C	OF INTENTION TO: SUBSEQUE	AT REFORT OF
•		
	PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
PERFORM REMESTAL WORK	COMMENCE DRILLING OPHS.	PLUG AND ABANDONMENT
TEMPORARILY ABANDON		
PULL OR ALTER CASING	CHANGE PLANS CASING TEST AND CEMENT JOB	
	OTHER	
Addl. Peri	s in San Andres X	
OTHER		
	ted Operations (Clearly state all pertinent details, and give pertinent dates, includ	ing estimated date of starting any proposes
17. Describe Proposed or Comple	ted Operations (Clearly state all pertinent actions, and green	
work) SEE RULE 1103.		
	Pull rods and pump. Install BOP. Pull tubing.	
1. Rigged up.	Pull ress and pump. Imposer nor. rear our ing.	
2. Clean out to	TD, 4720'.	or or 30 or 1/00 15
3. Perforate $5\frac{1}{2}$	TD, 4720. Casing W/2-JSPF @ 4316,21,27,33,41,67,84,87,94,44	01,07,13,25,4609, 15,
10 00 00 00 1	18 IO EO E7 61 8 H666!	
10,22,27,29	38,40,50,57,61,& 4666'. 240'. Acidize perfs 4316-4666 W/8200 gals 15% NE A	oid in L-Stages
4. Set p. 🕾 . @ 44	240'. Acidize peris 4310-4000 W/O200 gais 1) h ha r	CTG III + pogeo
using 1200# 1	rock salt and 1200 moth balls between stages.	
5 Inatell numn	ing equipment. Test and place on production.	
5. Install pump	tite oder Smorta. Top a men Santa Land	
•		

DATE 10-6-83
OCT 111983