

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-101
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. 1-6901
7. Unit Agreement Name
8. Farm or Lease Name Mesa Meritt State
9. Well No. #1
10. Field and Pool, or Wildcat Wildcat UNDESIGNATED
12. County Lea

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator Dinero Operating Company
3. Address of Operator Post office Drawer 10505; Midland, Texas 79702
4. Location of Well UNIT LETTER <u>F</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>19</u> TOWNSHIP <u>18-S</u> RANGE <u>35-E</u> N.M.P.M.
15. Elevation (Show whether DF, RT, GR, etc.) 3959 G.L.

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-30-82/Set 4 1/2 c-l-bridge plug at 10,000 ft.
5-1-82/Spotted 5 sx.cement on plug 65 ft. Displace hole with 10 lb. salt water jel with brime.
5-3-82/Cut 4 1/2 casing off at 7490. Pull & layed it all down 174 ft.
5-4-82/Run tubing to 7554 and spotted 40 Sx.
5-5-82/ went in and tag plug at 7397. Pull up to 7230 set 40 sx plug in 7 5/8 open hole
calculated top at 7041 pull up to 5314 AND spotted 49 sx. calculated to 5125.
came up to 4898 and spotted 100 sx.
5-6-82/tag plug at 4624 in perforation spotted 25 more sx.
5-7-82/tag plug at 4579 - came up to 757 & spotted 59 sx.
5-8-82/tag plug at 704 so spotted 25 more sx.
5-10-82/tag plug at 644. came up to 473 and spotted 66 sx. Cut off 13 5/8 well head
rig down spotted 10 sx. at surface & set dry hole marker. Cut off anchors.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.
Signed Lavanda J. Hama Bucky Buris TITLE Pusher - DA & S Well Service DATE May 24, 1982
Signed Bucky Buris Bucky Buris TITLE Pusher - DA & S Well Service DATE 5-10-82

APPROVED BY U. S. Stutman TITLE OIL & GAS INSPECTOR DATE JUL 2 1982
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

MAY 27 1982

O.C.D.
HOBBS OFFICE