Submit 3 Copies to Appropriate District Office

State of New Mexico Ene. b., Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

District Office OIL CONSERVATION DIVISION DISTRICT I WELL API NO. P.O. Box 1980, Hobbs, NM 88240 P.O. Box 2088 30-025-25134 DISTRICT II Santa Fe, New Mexico 87504-2088 5. Indicate Type of Lease P.O. Drawer DD, Artesia, NM 88210 STATE FEE 6. State Oil & Gas Lease No. 1000 Rio Brazos Rd., Aztec, NM 87410 LG-714 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) Yates State 1. Type of Well: METT [OTHER 2. Name of Operator 8. Well No. Lanexco, Inc. 9. Pool name or Wildcat 3. Address of Operator P.O. Box 1206 Jal, NM 88252 Eumont Yates SRQ Well Location S 660 _ : 1980 Feet From The Ε Feet From The Line Range **NMPM** County Township **18**S 10. Elevation (Show whether DF, RKB, RT, GR, etc.) Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 11. NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: **ALTERING CASING** PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK **CHANGE PLANS** PLUG AND ABANDONMENT **TEMPORARILY ABANDON** COMMENCE DRILLING OPNS. **PULL OR ALTER CASING** CASING TEST AND CEMENT JOB OTHER: OTHER:_ 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 9-3-92 Move in plugging unit and equipment. Lay down rods. Rig up BOP and pull tubing. Ran a 5½" cast iron bridge plug and set at 38/0 ft. 9-4-92 Circulate salt gel and brine from 3800 ft. to surface. Spot 35 ft. cement on top of CIBP. Spot 25 sacks cement at 1600 ft. - 1500 ft. Perforat 4 holes in 5½ casing at 450 ft. Break circulation and circulate 147 sacks cement inside $5\frac{1}{2}$ and between $5\frac{1}{2}$ and 8 5/8 back to surface. Dug cellar out to 8 5/8 casing head. 9-5-92 Cut off casing heads. Install dryhole marker. Cut off deadmen. 10-14-92 Remove all equipment. Back fill cellar and pit. Level location, clear off caliche. Remove all trash and debri. I hereby certify that the information above is true Production Superintendent 10-26-92 SIONATURE Mike Copeland TELEPHONE NO 395 - 3056 TYPE OR FRINT NAME

APPROVED BY

(This space for State Use)

/1

NOV 16'92