

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-25712
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	B-1306
7. Lease Name or Unit Agreement Name	Central Vacuum Unit
8. Well No.	101
9. Pool name or Wildcat	Vacuum Grayburg San Andres
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3976' GR

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
OIL WELL ☐ GAS WELL ☐ OTHER Water Injection ☐  
2. Name of Operator  
Texaco Exploration and Production Inc.  
3. Address of Operator  
P.O. Box 730 Hobbs, New Mexico 88240  
4. Well Location  
Unit Letter G : 1410 Feet From The North Line and 1336 Feet From The East Line  
Section 6 Township 18-S Range 35-E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
3976' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 2/14/91 - 2/22/91

1. MIRU, INSTALL BOP, WORK TBG. TOH W/RICE TBG, RECORDED 140 JTS 2 3/8" (4300') TBG. - LEFT 4 1/2" LOK-SET PKR, PREP TO FISH.
2. TIH W/SPEAR & B. SUB ON 2 3/8" TBG TO 4300', LATCH ON, TOH - NO REC. REDRESS SPEAR, TIH TO 4270', LATCH ON, TOH - NO REC. REDRESS SPEAR, TIH TO 4210', TOH - NO REC. TIH W/3 1/8" T. TAP, ATTEMPT TO LATCH @ 3542', TOH - NO REC.
3. TIH W/ SPEAR, B. SUB ON 2 3/8" WS, LATCH ON @ 3542', TOH - REC PKR, TIH W/3 1/8" T. TAP, B. SUB TO 4760', SCREW INTO MANDREL, TOH - REC MANDREL, LAY DN FISH.
4. TIH /PKR, TREAT PERFS W/ SODIUM PEFBORATE & ACIDIZE W/3000 GAL 15% NEFE ACID.
5. TOH W/ TREATING EQUIP.
6. TIH W/INJ EQUIP, PLACE ON INJECTION. PRIOR 131 BWPD @ 965 PSI  
AFTER 289 BWPD @ 875 PSI

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Engineer's Assistant DATE 12-31-91  
TYPE OR PRINT NAME TELEPHONE NO. 393-7191

(This space for State Use)

APPROVED BY [Signature] TITLE [Signature] DATE JAN 07 '92  
CONDITIONS OF APPROVAL, IF ANY: