

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

1
R
3
-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 3002525822
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011122
7. Lease Name or Unit Agreement Name Central Vacuum Unit
8. Well No. 129
9. Pool name or Wildcat Vacuum Grayburg S-Andres
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER injection
2. Name of Operator Texaco E&P Inc.
3. Address of Operator P.O. Box 3109 Midland, TX 79702
4. Well Location Unit Letter C : 1260 Feet From The North Line and 2560 Feet From The West Line Section 7 Township 18S Range 35E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify NMOCD of intent to plug & abandon well prior to moving unit on well.
2. Est. injection rate down tub w/Watson G PKR @ 4569, Pump 150 sxs cmt. into perf. @ 4612-4751. (San Andres) displace cmt. just below PKR. WOC & tag.
3. POOH to 4000'. Spot 20 sxs cmt. 4000-3900 (Queens) WOC & tag.
4. POOH to 3000'. Spot 55 sxs cmt. f/3000-2700 (Yates-7" csg shoe-B salt) WOC & tag.
5. POOH to 1755'. Spot 20 sxs cmt. f/1755-1655 (Top salt) WOC & tag.
6. POOH to 1590'. Spot 20 sxs cmt. f/1590-1490 (9-5/8" shoe) WOC & tag.
7. POOH to 410'. Spot 20 sxs cmt. f/410-310 (13-3/8" shoe)
8. POOH to 30. Spot 10 sxs cmt. f/50 to surface.
9. Cut off wellhead & weld on cap & install dry hole marker.

25 SXS MINIMUM

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE RJ Harding III TITLE Operations Engineer DATE 10-5-94
TYPE OR PRINT NAME RJ Harding III TELEPHONE NO. 915-688-481

(This space for State Use)

OCT 12 1994

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: