

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen a well in a Federal reservoir.  
Use "APPLICATION FOR PERMIT" for such proposals.

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Nadel and Gussman Permian

3. Address and Telephone No.

601 N Marienfeld, Suite 508, Midland, Texas 79701

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1650' FNL & 330' FWL  
Unit 1, Sec 35, T18S, R32E

E

5. Lease Designation and Serial No.  
NM 25513

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Berry Federal #1

9. API Well No.

30 - 025 - 26709

10. Field and Pool, or Exploratory Area

Querecho Plains Yates N.

11. County or Parish, State

Lea Co., NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent  
☐ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other

- ☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

1. MIRU. Unseat pump and POH w/ rods. Unflange well head.. POH w/ 2-3/8" tubing.
2. By wireline, set CIBP at 3200' and cap w/ 35' cement. Load casing with 10 PPG salt gel mud.
3. Spot 25 sx cement plug across top of salt from 1100' - 1450'. WOC and tag plug.
4. Spot 25 sx ug across surface casing shoe from 200' - 550'. WOC and tag plug.
5. Spot 5 sx plug at surface, cut off wellhead and set standard 4' dry hole marker.
6. RD and clean location.
7. Remove tanks, flowlines, pumping unit and other equipment.

Approval Subject To Plugging Operations  
Being Commenced By 09/20/2000 To Satisfy  
Incident of Noncompliance AJM-234-00.

14. I hereby certify that the foregoing is true and correct

Signed [Signature] Title R. McNaughton -Operations Engineer

Date 8-10-00

(This space for Federal or State office use)

Approved by (ORIG. SGD.) DAVID R. GLASS Title PETROLEUM ENGINEER

Date AUG 21 2000

Conditions of approval, if any:

SEE ATTACHED FOR

Title 18 U.S.C. Section 1004 makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

\*See Instruction on Reverse Side

GWW

207


# MADEL AND GUSSMAN PERM

## Berry Federal #1

1650' FNL, 330' FWL, Unit E, Sec 35, 18S, 32E, Eddy County, NM

API # 30-025-26709

Elev. 3715', KB = 3727'

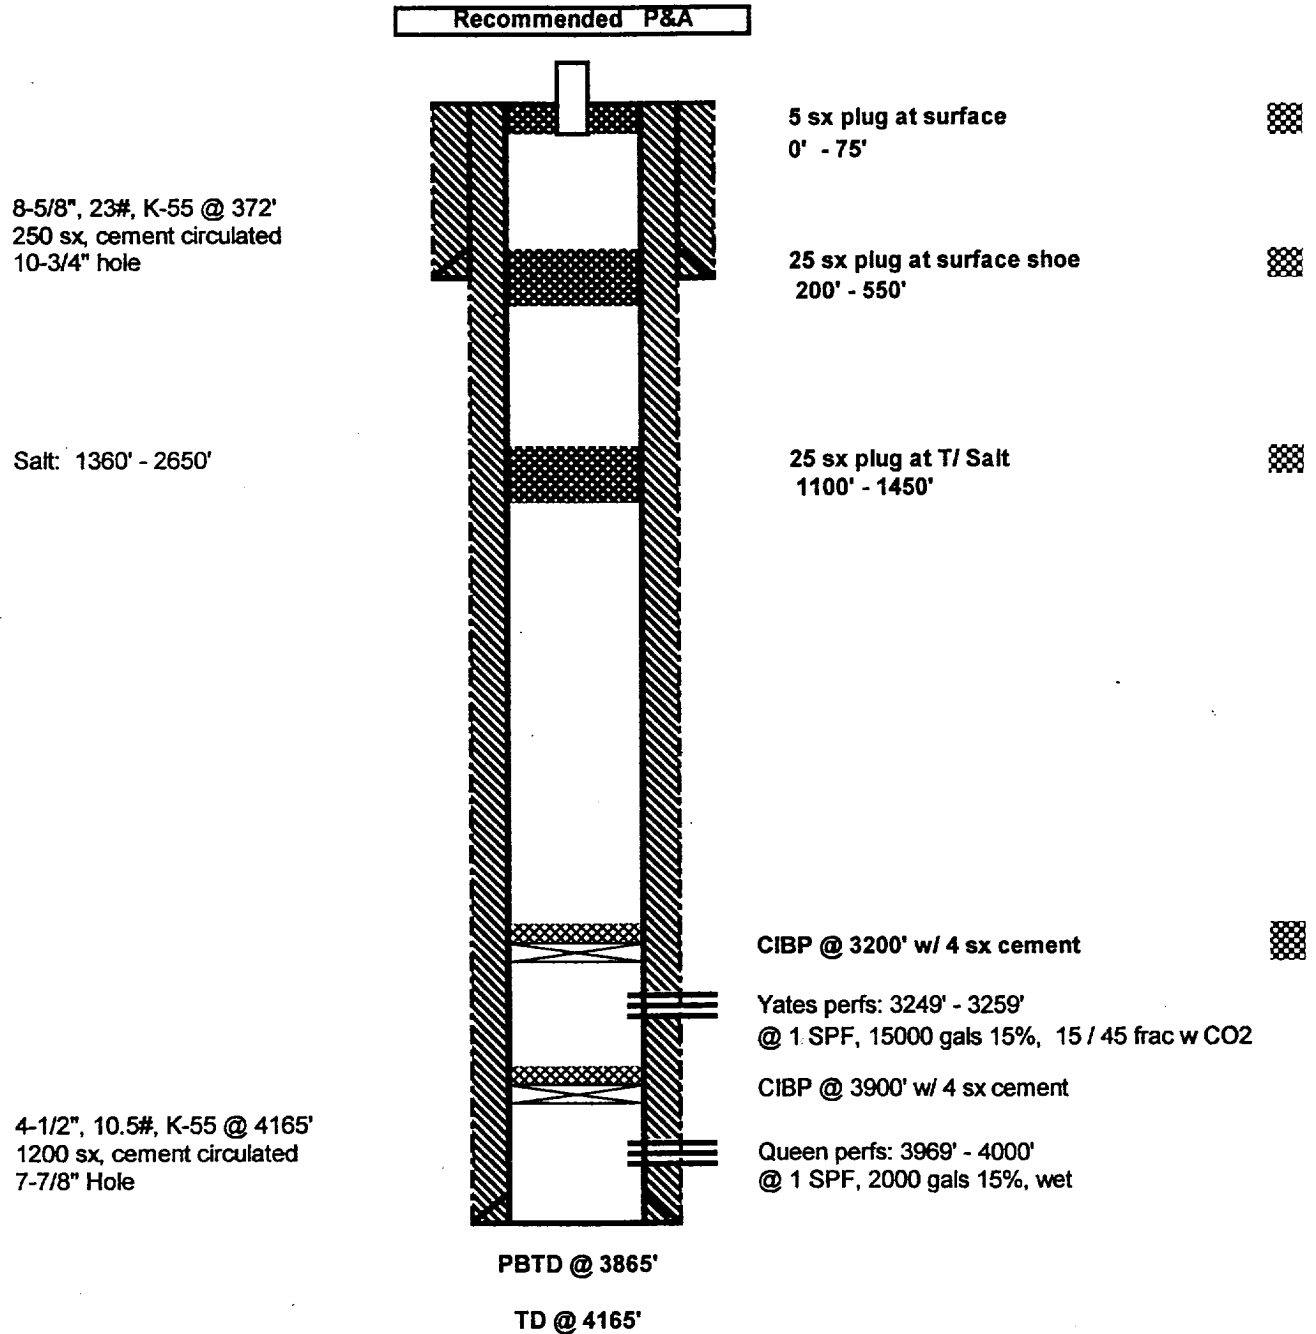

Federal Lease Number: NM - 25513