

Recommended work procedure cont.

Mid America "A" State #1

POH w/ ws to 600'. spot 30 sx. class "C" cmt. Plug from 600' to 489'.

POH w/ ws to 15'. Spot 3 sx class "C" cmt . Plug from 15' to 4' BGL. POH w/ ws.

RD. Cut off csg. 4' BGL. Weld on steel plate and dry hole marker. Reclaim location. RR.

Note: Notify NMO & GCC 24 hrs prior to beginning operations.

All calcs. based on use of class "C" cmt, w/a yield of 1.32 FT3/sk.

Displace all plug w/ 9.5 ppg mud laden fluid.