

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

CONTACT RECEIVING
OFFICE FOR NUM
OF COPIES RECD.
(Other instructions on re-
verse side)

BLM Roswell District
Modified Form No.
NM60-3160-4

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		3a. Area Code & Phone No. 505 393-4121		5. LEASE DESIGNATION AND SERIAL NO. NM-16357	
2. NAME OF OPERATOR Chevron U.S.A. Inc.		3b. Area Code & Phone No.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR P.O. Box 670 Hobbs NM 88240		3c. Area Code & Phone No.		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit K 1980 FSL + 1980 FWL		3d. Area Code & Phone No.		8. FARM OR LEASE NAME Langite Fed A Com	
14. PERMIT NO.		15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3675 GR		9. WELL NO. 1	
				10. FIELD AND POOL, OR WILDCAT T. B. B. - SEVEN RIVERS	
				11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA SEC 9 T19S R33E	
				12. COUNTY OR PARISH LEA	
				13. STATE NM	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)

PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)

REPAIRING WELL
ALTERING CASING
ABANDONMENT*

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Set CIBP @ 10250' CAP W/35' cmt. circ hole w/240 bbls P.A. Mud spot 100 sx plug across 5 1/2" CSG. stub. tag plug @ 7640'. Spot 130 sx plug @ 5281' tag plug @ 506 66' below 8 5/8" CSG. shoe. spot 65 sx plug 5064'/4848'. Tag plug @ 4903' Set CIBP @ 472' Log from 4716' to 2700'. perf @ 3639'-3670' w/1 JHPFO phasing. Acid 2 w/1500 gals 7 1/2% NEFE HCL + 1500 gals CO2. FRAC 7 RIVER PERFS 3939' 3670' w/7000 gals 40" XL + CO2 FORM. REPERF 7 RIVERS w/4" HSC 1 JHPFO DEG PHASING 10 HOLES 3572'-3626' ACID 2 3572'-3626' w/3000 gals 7 1/2% NEFE HCL. FRAC 3572'-3670' w/33760 gals FW w/2% KCL 40" X Link gel + 56340# 20/40 SAND.

Work started 7/26/90
Work. END 8/13/90

DATED FOR RELEASE
Adan

SEP 04 1990

CARISBAND, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED M. E. Alvarado 8/24/90

TITLE Staff Delg. Engr.

DATE 8/25/90

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side