

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease

State ☒ Fee ☐

5. State Oil & Gas Lease No.

LG 887

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☐ OTHER- P&A

2. Name of Operator

Yates Petroleum Corporation

3. Address of Operator

207 South 4th St., Artesia, NM 88210

4. Location of Well

UNIT LETTER A 330 FEET FROM THE North LINE AND 660 FEET FROM
THE East LINE, SECTION 2 TOWNSHIP 18S RANGE 37E NMPM.

7. Unit Agreement Name

8. Farm or Lease Name

Blarney Stone VS State

9. Well No.

1

10. Field and Pool, or Wildcat

Und. Lovington Penn

15. Elevation (Show whether DF, RT, GR, etc.)

3695' GR

12. County

Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

TEMPORARILY ABANDON ☐

PULL OR ALTER CASING ☐

PLUG AND ABANDON ☒

CHANGE PLANS ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

COMMENCE DRILLING OPNS. ☐

CASING TEST AND CEMENT JOBS ☐

OTHER ☐

ALTERING CASING ☐

PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon well as follows:

1. Pull tubing and packer out of hole.
2. Set CIBP at 5400' and cap w/35' cement.
3. Cut and pull 5½" casing from 4400'.
4. Spot 100' cement plug across 5½" casing stub (50' in and 50' out).
5. Spot 200' cement plug from 3385-3185'. This plug will cover 8-5/8" casing shoe (3335') and base of salt (3237').

NOTE: Tag 5½" casing stub plug and 8-5/8" casing shoe plug.

6. Spot 100' cement plug across top of salt from 2170-2070'.
7. Spot 100' cement plug across 13-3/8" casing setting point 580-480'.
8. Set 10 sacks cement plug at surface and install regulation abandonment marker.

Use 10#/gal salt gel mud between plugs.

Verbal approval for the above plugging procedure given by Mr. Eddie Seay, NMOCD, Hobbs, on 3-18-83.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton

TITLE Production Supervisor

DATE 3-18-83

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

MAR 22 1983

RECEIVED

MAR 21 1983

O.C.D.
HOBBES OFFICE