

Sloan Federal.

Page 2.

17.

- 5-10: RIH w/ 2-7/8 WS, tag cmt plug @ 7310, pull 2-7/8 WS to 4154. Spot 50 sxs class "C" cmt plug 4154-3977, pull tbg to 2500', WOC 5 hrs, RIH w/ 2-7/8 WS tag cmt plug @ 4084, Spot 10 sxs class "C" plug 4084-4050, pull 2-7/8 WS to 2635, Spot 40 sxs class "C" cmt plug 2635-2489, POH.
- 5-11:RIH w/ 2-7/8 WS to 950', Spot 40 sxs cmt plug 950-804, pull tbg to 50', Spot 15 sxs cmt plug 50-to surface, Nipple dwn BOP & well head, cln out cellar, cut off surface head 4' below ground level, weld on steel plate, Install dry hole marker, Rig dwn.

RECEIVED
MAY 26 1986
FBI
MAIL OFFICE