

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.E.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No.	
V-803	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - I" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. Unit Agreement Name
2. Name of Operator		8. Farm or Lease Name
Morris R. Antweil		State H.S.
3. Address of Operator		9. Well No.
P.O. Box 2010, Hobbs, NM 88241		1
4. Location of Well		10. Field and Pool, or Wildcat
UNIT LETTER <u>G</u> 1980 FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM		Undesignated
THE <u>East</u> LINE, SECTION <u>36</u> TOWNSHIP <u>18S</u> RANGE <u>38E</u> NMPM.		
15. Elevation (Show whether DF, RT, GR, etc.)		12. County
3599.3 GR		Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐		COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	CHANGE PLANS ☐	CASING TEST AND CEMENT JOBS ☐	
OTHER ☐		OTHER <u>Perforate, Acidize, and Test</u> ☒	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 8000'. PBTD 7910'. Tested casing to 2000 psi - OK. Perforated Abo with single shots at 7613', 7614', 7617', 7618', 7647', 7648', 7695', 7696', 7722', 7723', 7727', 7728', 7733', 7734', 7748', 7749', 7785½', 7786½', 7792', and 7793' (20 holes). Acidized with 6000 gals 15% NEFE acid at 5.7 BPM and 6540 psi. ISIP 5150. 15 minsip 4300. Swabbed 203 Bbls water with no oil cut. Set CIBP @ 6955' and capped w/20' cement. Tested to 2000 psi. Perforated Blinebry @ 6643½', 6644½', 6646½', 6657½', 6658½', 6661½', 6668½', 6669½', 6685', 6687', 6688', 6705', 6706', 6713', 6714', 6718', 6719', 6735', and 6736' (19 holes). Acidized w/5000 gals 15% NEFE acid at 6.5 BPM and 3500 psi. Swabbed 265 BW with no oil show. Set CIBP @ 4750' and capped w/20' cement. Tested to 2000 psi. Perforated San Andres w/single shots @ 4480', 4482½', 4485', 4488', 4491', 4494', and 4497' (7 holes). Acidized w/2000 gals 15% NEFE acid @ 3.2 BPM and 3100 psi. ISIP 2000, 1 min. vacuum. Swabbed 194 Bbls fluid with final hour 6.5 BF with 10% oil cut. Put on pump.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Jerry Sexton</u>	TITLE <u>Agent</u>	DATE <u>8/13/84</u>
ORIGINAL SIGNED BY JERRY SEXTON		AUG 15 1984
APPROVED BY <u>DISTRICT 1 SUPERVISOR</u>	TITLE _____	
CONDITIONS OF APPROVAL, IF ANY:		

RECEIVED

AUG 14 1984

U.S.
NORAD OFFICE