

ATTACHMENT

Cities Service Oil & Gas Corp. #5 Federal AD  
Sec. 9-T18S-R33E, Lea County, New Mexico

4. Perforate the Queen Formation w/4 SPF @ 4275, 77, 83, 84, 85, 86, 89, 90 and 4291'. Total of 36 holes.
5. RIH w/packer on 2-7/8" tubing and set the packer @ 4150'. Acidize thru the Queen Perfs @ 4275 - 4291' w/2000 gals of 7-1/2% NeFe HCL acid. Recover the load and treatment and swab test.
6. Frac thru the Queen Perfs @ 4275 - 4291' w/22,000 gals crosslinked gelled 2% KCL water w/5% diesel + 6000# 20/40 sand + 58,000# 12/20 sand. Recover load and treatment and swab test. POOH w/tubing and packer.
7. RIH w/2-3/8" production tubing, ND BOP and NU WH. RIH w/rods and BHP and put the well on production for a potential test.